

 適航指令發布單 Airworthiness Directive Issuance Form			
民航局 AD 編號 AD number	CAA-2017-03-004	發布日期 Date issued	2017/3/14
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342 and A330-343 aeroplanes, all manufacturer serial numbers (MSN), and Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.		
主旨摘要	Flight Controls - Trimmable Horizontal Stabilizer Actuator and Upper Attachment - Inspection		
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____		
	設計國 AD 編號 Original AD number	2017-0044	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 27. Ref. Publications: Airbus SB A330-27-3218 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016. and Airbus SB A340-27-4203 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016. and Airbus SB A340-27-5067 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016.		
註： Note：	1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel:(02)2349-6331~3, Fax:(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw		



Airworthiness Directive

AD No.: 2017-0044

Issued: 09 March 2017

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A330 and A340 aeroplanes

Effective Date: 23 March 2017

TCDS Number(s): EASA.A.004 and EASA.A.015

Foreign AD: Not applicable

Supersedure: None

ATA 27 – Flight Controls – Trimmable Horizontal Stabilizer Actuator and Upper Attachment – Inspection

Manufacturer(s):

Airbus (formerly Airbus Industrie)

Applicability:

Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342 and A330-343 aeroplanes, all manufacturer serial numbers (MSN), and

Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.

Reason:

The Trimmable Horizontal Stabilizer Actuator (THSA), as installed on A330 and A340 aeroplanes, was initially designed to stall when engaging on the upper secondary load path (SLP) after primary load path (PLP) failure. Such stall triggers system monitoring detection. New mission profile analysis revealed that in some cases, the THSA could be operated while engaged on the upper SLP without stalling. The partial engagement of the SLP at upper attachment level does not trigger any indication to the flight crew.



This condition, if not detected and corrected, could lead to THSA upper attachment failure and consequent disconnection of the THSA from the aeroplane structure, possibly resulting in loss of control of the aeroplane.

For the reasons described above, this AD requires repetitive detailed inspections (DET) of the upper THSA attachments parts and the PLP and SLP fuselage attachment points, and, depending on findings, accomplishment of applicable corrective action(s).

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Note 1: Airbus SB A330-27-3218, SB A340-27-4203 and SB A340-27-5067, all at Revision 01, are hereafter collectively referred to as 'the applicable SB' in this AD.

Inspections:

- (1) Before exceeding the threshold as defined in Table 1 of this AD, as applicable to aeroplane type and model, or within 3 months after the effective date of this AD, whichever occurs later, and, thereafter, at intervals not to exceed the inspection interval values as defined in Table 1 of this AD, accomplish a DET of the THSA upper attachments and no-back housing in accordance with the instructions of the applicable SB.

Table 1 – THSA Upper Attachments / No-Back Housing Inspections

Affected Aeroplanes	Compliance Times (whichever occurs first, flight hours (FH) or flight cycles (FC))	
	Threshold (see Note 2 of this AD)	Inspection Interval (not to exceed)
A330, A340-200 and A340-300	4 000 FH or 1 000 FC	4 000 FH or 1 000 FC
A340-500 and A340-600	4 000 FH or 800 FC	4 000 FH or 800 FC

Note 2: The FH and FC referred to in column "Threshold" of Table 1 of this AD are those accumulated by the aeroplane since first flight, or since the last accomplishment of A330 or A340 Maintenance Review Board Report task 27.40.00/07, or since the last DET accomplished in accordance with the instructions of the applicable SB at original issue.

Corrective Action(s):

- (2) If, during any DET as required by paragraph (1) of this AD, any discrepancy as defined in the applicable SB is detected, before next flight, remove the THSA, accomplish a DET of the upper attachment fitting of the aeroplane and a DET of the removed THSA in accordance with the instructions of the applicable SB. As an alternative to the DET of the THSA, replace the THSA with a serviceable part (see Note 3 of this AD).
- (3) If, during any DET of the upper attachment fitting of the aeroplane, as required by paragraph (2) of this AD, any discrepancy as defined in the applicable SB is detected, before next flight, contact Airbus for approved instructions and accomplish those instructions accordingly.



- (4) If, during any DET of the removed THSA, as required by paragraph (2) of this AD, any discrepancy as defined in the applicable SB is detected, before next flight, replace the THSA with a serviceable part (see Note 3 of this AD) in accordance with the instructions of the applicable SB.

Note 3: For the purpose of this AD, a serviceable THSA is a part that has accumulated less than 4 000 FH or 1 000 FC (for A330, A340-200, or A340-300 aeroplanes) or 4 000 FH or 800 FC (for A340-500 or A340-600 aeroplanes), whichever occurs first since new, or since overhaul, or since the last inspection in accordance with the instructions of the applicable SB.

Credit for Previous Action(s):

- (5) Inspections and corrective actions on an aeroplane, accomplished before the effective date of this AD in accordance with the instructions of the applicable SB at original issue, are acceptable to comply with the initial requirements of this AD for that aeroplane.

Terminating Action:

- (6) None.

Ref. Publications:

Airbus SB A330-27-3218 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016.

Airbus SB A340-27-4203 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016.

Airbus SB A340-27-5067 original issue dated 01 July 2016, or Revision 01 dated 05 December 2016.

The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 20 January 2017 as PAD 17-010 for consultation until 17 February 2017. The Comment Response Document can be found at <http://ad.easa.europa.eu>.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – EIAL, E-mail: airworthiness.A330-A340@airbus.com.

