

|  適航指令發布單 Airworthiness Directive Issuance Form | | | |
|---|---|---------------------|----------|
| 民航局 AD 編號 AD number | CAA-2017-06-004 | 發布日期 Date issued | 2017/8/9 |
| 適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable) | Airbus A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-131, A321-211, A321-212, A321-213, A321-231 and A321-232 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 160055 or mod 160056 has been embodied in production, and except A319 aeroplanes on which mod 28162, 28238 and 28342 have been embodied ("Corporate Jet"). | | |
| 主旨摘要 | Fuselage - Potable Water and Waste Water Service Panels - Reinforcement | | |
| 民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other | 設計國民航主管機構 Original Authorities <input type="checkbox"/> FAA <input type="checkbox"/> Germany LBA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> CAA-NL <input type="checkbox"/> Brazil <input type="checkbox"/> UK CAA <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> Japan CAB <input type="checkbox"/> DGAC <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ | | |
| | 設計國 AD 編號 Original AD number | 2017-0098 | |
| | 1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No) | | |
| 備註 Note | ATA 53. This AD supersedes EASA AD 2014-0081(CAA-2014-04-002) dated 31 March 2014. Ref. Publications: Airbus SB A320-53-1267 original issue dated 24 June 2013, or Rev. 01 dated 02 October 2013, or Rev. 02 dated 19 May 2014, or Rev. 03 dated 26 November 2015, or Rev. 04 dated 01 February 2016 or Rev. 05 dated 29 November 2016. and Airbus SB A320-53-1272 original issue dated 10 January 2013, or Rev. 01 dated 06 August 2013, or Rev. 02 dated 19 May 2014, or Rev. 03 dated 26 November 2015, or Rev. 04 dated 29 November 2016. | | |
| 註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw | | | |



Airworthiness Directive

AD No.: 2017-0098

Issued: 07 June 2017

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A319, A320, and A321 aeroplanes

Effective Date: 21 June 2017

TCDS Number(s): EASA.A.064

Foreign AD: Not applicable

Revision: This AD supersedes EASA AD 2014-0081 dated 31 March 2014.

ATA 53 – Fuselage – Potable Water and Waste Water Service Panels – Reinforcement

Manufacturer(s):

Airbus (formerly Airbus Industrie)

Applicability:

Airbus A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-131, A321-211, A321-212, A321-213, A321-231 and A321-232 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 160055 or mod 160056 has been embodied in production, and except A319 aeroplanes on which mod 28162, 28238 and 28342 have been embodied ("Corporate Jet").

Reason:

During the full scale fatigue test on A320-200, it was noticed that, due to fatigue, cracks could initiate at the potable water and waste water service panel areas.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

Prompted by these findings, Airworthiness Limitation Section (ALS) Part 2 tasks were introduced for the affected aeroplanes. Since those actions were taken, Airbus developed production mod 160055 and mod 160056 to embody reinforcements (cold working on certain rivet rows) of the potable



water and waste water service panels, and published associated Airbus Service Bulletin (SB) A320-53-1272 and Airbus SB A320-53-1267 for in-service embodiment. Complementary design office studies highlighted that the “Sharklets” installation on certain aeroplanes has a significant impact on the aeroplane structure (particularly, A319 and A320 post-mod 160001, A320 post-SB A320-57-1193 (mod 160080), and A321 post-mod 160021), leading to different compliance times, depending on aeroplane configuration.

Consequently, EASA issued AD 2014-0081 to require reinforcement of the potable water and waste water service panels. Accomplishment of these modifications cancelled the need for the related ALS Part 2 Tasks.

Since that AD was issued, further investigations linked to the Widespread Fatigue Damage (WFD) analysis highlighted that, to meet the WFD requirements, it is necessary that the affected modification is not accomplished before reaching a certain threshold, by imposing a so-called “window of embodiment”. Consequently, Airbus revised SB A320-53-1272 (now at revision (Rev.) 04) and SB A320-53-1267 (now at Rev. 05).

For the reasons described above, this AD retains the requirements of EASA AD 2014-0081, which is superseded, and introduces additional compliance times for those actions.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

- (1) Within the compliance times as specified in Appendix 1 of this AD, as applicable, modify the potable water service panel in accordance with the instructions of Airbus SB A320-53-1272 Rev. 04.
- (2) Within the compliance times as specified in Appendix 2 of this AD, as applicable, modify the waste water service panel in accordance with the instructions of Airbus SB A320-53-1267 Rev. 05.
- (3) For aeroplanes on which the modification, as required by paragraph (1) or (2) of this AD, as applicable, was accomplished before reaching the applicable threshold (window of embodiment) as defined in Appendix 1 or 2 of this AD, as applicable, before exceeding 60 000 flight cycles (FC) since aeroplane first flight, contact Airbus for approved corrective action instructions and accomplish those instructions accordingly.
- (4) Modification of an aeroplane, prior to the effective date of this AD in accordance with the instructions of Airbus SB A320-53-1272 at original issue, or Rev. 01, or Rev. 02, or Rev. 03 is acceptable to comply with the requirements of paragraph (1) of this AD for that aeroplane. Requirements of Paragraph (3) of this AD remain applicable.

Modification of an aeroplane, prior to the effective date of this AD in accordance with the instructions of Airbus SB A320-53-1267 at original issue, or Rev. 01, or Rev. 02, or Rev. 03, or Rev. 04 is acceptable to comply with the requirements of paragraph (2) of this AD for that aeroplane. Requirements of Paragraph (3) of this AD remain applicable.



- (5) Modification of an aeroplane as required by paragraph (1) of this AD cancels the need to accomplish the ALS Part 2 task for that aeroplane as specified in Table 1 of this AD, as applicable.

Table 1 – ALS Part 2 Task terminated after Potable Water Service Panel Reinforcement

| Affected Aeroplanes | ALS Part 2 Task N° |
|---|---------------------------|
| A319, pre-mod 160001 and pre-SB A320-57-1193 | 534125-01-2 |
| A319, post-mod 160001 or post-SB A320-57-1193 | 534125-01-5 |
| A320, pre-mod 160001 and pre-SB A320-57-1193 | 534125-01-3 |
| A320, post-mod 160001 or post-SB A320-57-1193 | 534125-01-6 |
| A321 pre-mod 160021 | 534125-01-4 |
| A321 post-mod 160021 | 534125-01-7 |

- (6) Modification of an aeroplane as required by paragraph (2) of this AD cancels the need to accomplish the ALS Part 2 task for that aeroplane as specified in Table 2 of this AD, as applicable.

Table 2 – ALS Part 2 Task terminated after Waste Water Service Panel reinforcement

| Affected aeroplanes | ALS Part 2 Task N° |
|---|---------------------------|
| A319, pre-mod 160001 and pre-SB A320-57-1193 | 534126-01-2 |
| A319, post-mod 160001 or post-SB A320-57-1193 | 534126-01-5 |
| A320, pre-mod 160001 and pre-SB A320-57-1193 | 534126-01-3 |
| A320, post-mod 160001 or post-SB A320-57-1193 | 534126-01-6 |
| A321 pre-mod 160021 | 534126-01-4 |
| A321 post-mod 160021 | 534126-01-7 |

Ref. Publications:

Airbus SB A320-53-1267 original issue dated 24 June 2013, or Rev. 01 dated 02 October 2013, or Rev. 02 dated 19 May 2014, or Rev. 03 dated 26 November 2015, or Rev. 04 dated 01 February 2016 or Rev. 05 dated 29 November 2016.

Airbus SB A320-53-1272 original issue dated 10 January 2013, or Rev. 01 dated 06 August 2013, or Rev. 02 dated 19 May 2014, or Rev. 03 dated 26 November 2015, or Rev. 04 dated 29 November 2016.



The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 20 March 2017 as PAD 17-035 for consultation until 17 April 2017. The Comment Response Document can be found at <http://ad.easa.europa.eu> in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the Safety Information Section, Certification Directorate, EASA. E-mail: ADs@easa.europa.eu.
4. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – EIAS; Fax +33 5 61 93 44 51;
E-mail: account.airworth-eas@airbus.com.



Note 1: For the purpose of Appendix 1 and 2 of this AD, A321-111, A321-112 and A321-131 aeroplanes are collectively referred to as “A321-100”. Similarly, A321-211, A321-212, A321-213, A321-231 and A321-232 aeroplanes are collectively referred to as “A321-200”.

Appendix 1 – Potable Water Service Panel Reinforcement

| Affected Aeroplanes (see Note 1 of this AD) | Modification Threshold (window of embodiment – not before accumulating the specified FC since aeroplane first flight) | Compliance Time (before exceeding the specified FC since aeroplane first flight) |
|---|---|--|
| A319, pre-mod 160001 and pre-SB A320-57-1193 | 33 100 FC | 48 500 FC |
| A319, post-mod 160001 or post-SB A320-57-1193 | None | 46 000 FC |
| A320, pre-mod 160001 and pre-SB A320-57-1193 | 25 100 FC | 54 200 FC |
| A320, post-mod 160001 or post-SB A320-57-1193 | None | 48 300 FC |
| A321-100 | 25 100 FC | 60 000 FC |
| A321-200 pre-mod 160021 | 22 100 FC | |
| A321-200 post-mod 160021 | None | |



Appendix 2 – Waste Water Service Panel Reinforcement

| Affected Aeroplanes (see Note 1 of this AD) | Modification Threshold (window of embodiment – not before accumulating the specified FC since aeroplane first flight) | Compliance Time (before exceeding the specified FC since aeroplane first flight) |
|---|---|--|
| A319, pre-mod 160001 and pre-SB A320-57-1193 | 38 600 FC | 44 400 FC |
| A319, post-mod 160001 or post-SB A320-57-1193 | None | 43 600 FC |
| A320, pre-mod 160001 and pre-SB A320-57-1193 | 35 800 FC | See Appendix 3 of this AD |
| A320, post-mod 160001 or post-SB A320-57-1193 | 5 400 FC | 39 200 FC |
| A321-100 | 36 900 FC | 52 500 FC |
| A321-200 pre-mod 160021 | 35 700 FC | 53 500 FC |
| A321-200 post-mod 160021 | None | 51 200 FC |

Appendix 3 – Waste Water Service Panel Reinforcement for A320 aeroplanes, pre-mod 160001 and pre SB A320-57-1193

| Compliance Time (whichever occurs later, A or B) | |
|--|---|
| A | Before exceeding 46 400 FC since aeroplane first flight |
| B | Within 2 300 FC since last accomplishment of ALS Part 2 Task N°534126-01-3 without exceeding 48 000 FC since aeroplane first flight |

