



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2017-06-008B	發布日期 Date issued	2018/3/26
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342 and A330-343 aeroplanes, all manufacturer serial numbers.		
主旨摘要	Electrical Power - Alternating Current Emergency Generation - Flight Warning Computer Software Update		
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <div style="display: flex; justify-content: space-between;"> <div style="width: 48%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 48%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2017-0105R2	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 24.This AD revises EASA AD 2017-0105R1(CAA-2017-06-008A) dated 17 July 2017. The original issue of this AD superseded EASA AD 2014-0281, dated 22 December 2014. Ref. Publications: Airbus A330 AFM TR 427 issue 1 EASA approved on 14 October 2014. and AFM DU EMER-24-00005218.0001001, EASA approved on 20 December 2016. and Airbus A330 AFM TR 428 issue 1 EASA approved on 14 October 2014. and AFM DU EMER-24-00005218.0002001, EASA approved on 20 December 2016. and Airbus SB A330-31-3232 original issue dated 04 May 2016, or Revision 01 dated 14 February 2017. and Airbus SB A330-31-3237 original issue dated 30 January 2017. and Airbus SB A330-31-3229 original issue dated 14 November 2017.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			

Note : 1. The AD text is enclosed.
2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.
3. For further information, please contact Civil Aeronautics Administration on Tel : (02)2349-6331~3, Fax : (02)2545-8464, e-mail : adcaa@mail.caa.gov.tw

CAA Form ACS-P08-02

第一頁/共一頁



Airworthiness Directive

AD No.: 2017-0105R2

Issued: 16 March 2018

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A330 aeroplanes

Effective Date: Revision 2: 23 March 2018
Revision 1: 17 July 2017
Original issue: 28 June 2017

TCDS Numbers: EASA.A.004

Foreign AD: Not applicable

Revision: This AD revises EASA AD 2017-0105R1 dated 17 July 2017. The original issue of this AD superseded EASA AD 2014-0281, dated 22 December 2014.

ATA 24 – Electrical Power – Alternating Current Emergency Generation – Flight Warning Computer Software Update

Manufacturer(s):

Airbus (formerly Airbus Industrie)

Applicability:

Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342 and A330-343 aeroplanes, all manufacturer serial numbers.

Definition(s):

For the purpose of this AD, the following definitions apply:

Affected FWC: Flight Warning Computer (FWC) standard lower than T7-0, or a FWC standard lower than M6-0, as applicable to aeroplane configuration.

Serviceable FWC: FWC standard T7-0, Part Number (P/N) LA2E20202T70000, or higher standard, or FWC standard M6-0, Part Number (P/N) LA2E20202M60000, or higher standard, as applicable, depending on aeroplane configuration.



Groups: Group 1 aeroplanes are those that have an affected FWC installed. Group 2 aeroplanes are those that do not have an affected FWC installed.

Reason:

The Constant Speed Motor/Generator (CSM/G), as installed on Airbus A330 aeroplanes, is qualified for an overload condition of 9.5 kVA for 30 minutes. This duration is sufficient to perform safe landing and go-around. However, electrical load analysis revealed that the hydraulic power might not be sufficient to supply the CSM/G during slat/flap extension, when only one engine is running.

This condition, if not corrected, and in conjunction with the loss of main system, could lead to a scenario where the crew is not clearly warned that the electrical system has switched on the battery and thus has a limited duration to support a safe landing.

To initially address this potential unsafe condition, Airbus issued an Aircraft Flight Manual (AFM) Temporary Revision (TR) to amend the electrical emergency configuration “ELEC EMER CONFIG” procedure to require the pilot to deploy the ram air turbine manually before setting the Landing Recovery to “ON” position, which provides sufficient hydraulic power and avoids CSM/G shedding under worst-case operational conditions. Consequently, EASA issued AD 2014-0273 to require amendment of the AFM by incorporating the applicable Airbus TR.

After finding that AD 2014-0273 contained some incorrect and incomplete information, EASA issued AD 2014-0281, retaining the requirements of EASA AD 2014-0273, which was superseded, but correcting the information related to pre-mod / pre Service Bulletin (SB) or post-mod / post SB aeroplane configurations.

Since EASA AD 2014-0281 was issued, in order to improve the “ELEC EMER CONFIG” procedure, Airbus developed modifications to install improved Flight Warning Computer (FWC), which is embodied in production through Airbus modification (mod) 205228, and to be embodied in service with Airbus SB A330-31-3232, or SB A330-31-3237, or SB A330-31-3229, as applicable.

For the reasons described above, EASA issued AD 2017-0105 (later revised), retaining the requirements of EASA AD 2014-0281, which was superseded, and requires installation of a software standard upgrade of the two FWCs.

Since EASA AD 2017-0105R1 was issued, Airbus have issued SB A330-31-3229 and this AD is revised accordingly.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Restatement of the requirements of EASA AD 2014-0281:

AFM Amendment:

- (1) For Group 1 aeroplanes: Within 15 days after 05 January 2015 [the effective date of EASA AD 2014-0281], amend the applicable A330 AFM to incorporate the Airbus AFM TR as defined in Table 1 of this AD, as applicable, depending on aeroplane configuration, inform all flight crews, and thereafter, operate the aeroplane accordingly.



Table 1 – AFM Amendment

Aeroplane configuration	AFM TR
Pre-mod 47930; pre-SB A330-28-3067	TR 427 issue 1
Post-mod 47930; post-SB A330-28-3067	TR 428 issue 1

Amending the applicable AFM to incorporate a later AFM revision which includes A330 AFM TR 427 issue 1 or A330 AFM TR 428 issue 1, as applicable, is acceptable to comply with the requirements of paragraph (1) of this AD.

Note: Airbus published EMERGENCY PROCEDURES /24-ELECTRICAL POWER/ ELEC – EMER CONFIG Documentary Unit (DU) 00005218.0001001 and DU 00005218.0002001, as applicable, which are acceptable to be used for compliance with the requirements of paragraph (1) of this AD.

New requirements of this AD:

Modification:

- (2) For Group 1 aeroplanes: Within 24 months after 28 June 2017 [the effective date of the original issue of this AD], replace both FWCs with not affected FWCs in accordance with the instructions of Airbus SB A330-31-3232, or SB A330-31-3237, or SB A330-31-3229, as applicable, depending on aeroplane configuration.

AFM Amendment:

- (3) [Deleted].

Parts installation:

- (4) Do not install on any aeroplane an affected FWC, as required by paragraph (4.1) or (4.2) of this AD, as applicable.

(4.1) For Group 1 aeroplanes: After modification of the aeroplane as required by paragraph (2) of this AD.

(4.2) For Group 2 aeroplanes: From 28 June 2017 [the effective date of the original issue of this AD].

Ref. Publications:

Airbus A330 AFM TR 427 issue 1 EASA approved on 14 October 2014.

AFM DU EMER-24-00005218.0001001, EASA approved on 20 December 2016.

Airbus A330 AFM TR 428 issue 1 EASA approved on 14 October 2014.

AFM DU EMER-24-00005218.0002001, EASA approved on 20 December 2016.

Airbus SB A330-31-3232 original issue dated 04 May 2016, or Revision 01 dated 14 February 2017.

Airbus SB A330-31-3237 original issue dated 30 January 2017.

Airbus SB A330-31-3229 original issue dated 14 November 2017.



The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The original issue of this AD was posted on 12 May 2017 as PAD 17-060 for consultation until 09 June 2017. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – EIAL (Airworthiness Office), E-mail: airworthiness.A330-A340@airbus.com.

