

 適航指令發布單 Airworthiness Directive Issuance Form	
民航局 AD 編號 AD number	CAA-2018-01-004 發布日期 Date issued 2018/1/15
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 aeroplanes, manufacturer serial numbers (MSN) 0006 to 0040 inclusive, except MSN 0025, 0032, 0033, 0036, 0038 and 0039.
主旨摘要	Wings - Main Landing Gear Trunnion Block Fuse Pin Retaining Pins - Inspection / Replacement
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____
	設計國 AD 編號 Original AD number 2018-0008
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)
備註 Note	ATA 57. Ref. Publications: Airbus SB A350-57-P011 original issue dated 17 May 2017.
註： Note：	1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel:(02)2349-6331~3, Fax:(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw



Airworthiness Directive

AD No.: 2018-0008

Issued: 10 January 2018

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A350 aeroplanes

Effective Date: 24 January 2018

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Supersedure: None

ATA 57 – Wings – Main Landing Gear Trunnion Block Fuse Pin Retaining Pins – Inspection / Replacement

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 aeroplanes, manufacturer serial numbers (MSN) 0006 to 0040 inclusive, except MSN 0025, 0032, 0033, 0036, 0038 and 0039.

Reason:

Following an Airbus quality control review on the final assembly line, it was identified that short retaining pins may have inadvertently been installed at the incorrect location of the main landing gear support structure (MLGSS) forward pintle. On the A350, two short retaining pins are installed through the fuse pin carrier and four long retaining pins are installed through the trunnion block. These six retaining pins are to prevent rotation and migration of the fuse pins.

This condition, if not detected and corrected, could lead to premature failure of the retaining pin, subsequent fuse pin migration and disconnection, with consequent main landing gear collapse, possibly resulting in damage to the aeroplane and injury to the occupants.

To address this potential unsafe condition, Airbus issued Service Bulletin (SB) A350-57-P011 to provide inspection instructions.



For the reasons described above, this AD requires a one-time detailed inspection (DET) of the four retaining pins installed in the MLGSS trunnion block, both left hand (LH) and right hand (RH) sides, and, depending on findings, accomplishment of applicable corrective action(s).

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection(s):

- (1) Before exceeding 1 880 flight cycles (FC) since aeroplane first flight, accomplish a DET of the four retaining pins installed in the MLGSS trunnion block, both LH and RH sides, in accordance with the instructions of Airbus SB A350-57-P011.

Corrective Action(s):

- (2) If, during the inspection as required by paragraph (1) of this AD, damage or deformation is found on the non-conforming (incorrect) retaining pin(s), before next flight, contact Airbus for approved corrective action instructions and, within the compliance time as specified therein, accomplish those instructions accordingly.
- (3) If, during the inspection as required by paragraph (1) of this AD, no damage or deformation is found on the non-conforming (incorrect) retaining pins, before exceeding 1 880 FC since aeroplane first flight, replace the non-conforming / incorrect retaining pins in accordance with the instructions of Airbus SB A350-57-P011.

Ref. Publications:

Airbus SB A350-57-P011 original issue dated 17 May 2017.

The use of later approved revisions of this document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 15 December 2017 as PAD 17-172 for consultation until 05 January 2018. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. For any question concerning the technical content of the requirements in this AD, please contact: continued-airworthiness.a350@airbus.com.

