



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2018-05-006	發布日期 Date issued	2018/5/18
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	All balloon types and models, Austria BA 009-ACG, EASA.BA.001, EASA.BA.002, EASA.BA.003, EASA.BA.004, EASA.BA.010, EASA.BA.012, EASA.BA.013, EASA.BA.014, EASA.BA.015, EASA.BA.016, EASA.BA.017, EASA.BA.019, EASA.BA.021, EASA.BA.022, EASA.BA.025, EASA.BA.026, EASA.BA.028, EASA.BA.030, EASA.BA.109, EASA.BA.119, EASA.BA.120, EASA.BA.501, EASA.BA.502, EASA.BA.503, EASA.BA.504, EASA.BA.505, EASA.BA.506, EASA.BA.517, EASA.SAS.BA.001, EASA.SAS.BA.012, EASA.SAS.BA.023 and EASA.SAS.BA.025.		
主旨摘要	Fuel Cell Systems – Lindstrand T30 Propane Cylinders – Removal from Service		
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <div style="display: flex; justify-content: space-between;"> <div style="width: 48%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 48%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2018-0107	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 85. Ref. Publications: Cameron Balloons Limited SB 25, Revision 3 dated 07 November 2017.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			



Airworthiness Directive

AD No.: 2018-0107

Issued: 15 May 2018

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

BALLONS CHAIZE
 BALLONS LIBERT SPRL
 BALLONSERVICE & TECHNIK
 BALÓNY KUBÍČEK SPOL. S.R.O.
 CAMERON BALLOONS LTD
 LINDSTRAND TECHNOLOGIES LTD
 NOUVELLE MANUFACTURE D'AEROSTATS
 SCHROEDER FIRE BALLOONS GMBH
 ULTRAMAGIC S.A.

Type/Model designation(s):

Hot Air Balloons (see Applicability)

Effective Date: 29 May 2018

TCDS Number(s): Austria BA 009-ACG, EASA.BA.001, EASA.BA.002, EASA.BA.003, EASA.BA.004, EASA.BA.010, EASA.BA.012, EASA.BA.013, EASA.BA.014, EASA.BA.015, EASA.BA.016, EASA.BA.017, EASA.BA.019, EASA.BA.021, EASA.BA.022, EASA.BA.025, EASA.BA.026, EASA.BA.028, EASA.BA.030, EASA.BA.109, EASA.BA.119, EASA.BA.120, EASA.BA.501, EASA.BA.502, EASA.BA.503, EASA.BA.504, EASA.BA.505, EASA.BA.506, EASA.BA.517, EASA.SAS.BA.001, EASA.SAS.BA.012, EASA.SAS.BA.023 and EASA.SAS.BA.025.

Foreign AD: Not applicable

Supersedure: None

ATA 85 – Fuel Cell Systems – Lindstrand T30 Propane Cylinders – Removal from Service



Manufacturer(s):

114 (714) ZO Svazarmu, Aviatik Klub, Aerotechnik P.O.S., Aerotechnik s.r.o, Aerotechnik Podnik ÚV Svazarmu, Altisph'air, Annonay Air Concept, Ballons Libert Sprl, Ballons Chaize, Ballonservice & Technik, Balóny Kubíček spol. s.r.o., Cameron Balloons Ltd, Colt Balloons, Firma Johann Schön, Kubíček spol. s.r.o., Lindstrand Balloons Ltd (LBL), Lindstrand Hot Air Balloons Ltd, Llopis Balloons, Notheisz Balloons Hungary Kft., Pilatre De Rozier S.I.G.A. S.A., Schroeder fire balloons GmbH, Sky Balloons, SUP-AIR Ballon Egyesület, Thunder Balloons, Thunder & Colt, Ultramagic S.A., Lindstrand Technologies Ltd.

Notes:

1. The above list of manufacturers (some companies no longer exist) may not be complete, due to lack of historical data. In case a balloon manufacturer's name is not listed, that does not mean that this AD does not apply to that balloon – see the Applicability below.
2. The Lindstrand T30 cylinders were manufactured by Aeroecology (Russia) and introduced into service from 1995 with Lindstrand Hot Air Balloons Limited accepting Type Design responsibility for a batch of cylinders, some of which were allocated additional serial numbers.
3. Cameron Balloons Limited are the current Type Certificate Holder for some Types of Hot Air Balloons manufactured by Lindstrand Hot Air Balloons Limited.

Applicability:

All balloon types and models, as specified in the referenced TCDS listed above, all serial numbers.

Definition(s):

For the purpose of this AD, the following definitions apply:

The SB: Cameron Balloons Limited Service Bulletin (SB) 25, Revision 3.

Affected cylinder: Lindstrand T30 propane cylinders, Part Number CY050001, with a serial number as listed in the SB.

Reason:

A review of cylinder production records has shown that the affected cylinders have unacceptable welding defects.

This condition, if not detected and corrected, could result in an uncontrolled release of liquid propane and consequent fire or explosion, with consequent injury to balloon occupants and persons on the ground.

To address this potential unsafe condition, Cameron Balloons Limited issued the SB, providing instructions to remove the affected cylinders from service.

For the reasons described above, this AD requires replacement of the affected cylinders with serviceable parts.



Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Replacement:

- (1) Within 30 days after the effective date of this AD, replace each affected cylinder with a serviceable part in accordance with the instructions of the SB.

Part(s) Installation:

- (2) From the effective date of this AD, do not install on any hot air balloon an affected cylinder.

Ref. Publications:

Cameron Balloons Limited SB 25, Revision 3 dated 07 November 2017.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 09 March 2018 as PAD 18-035 for consultation until 06 April 2018. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. For any question concerning the technical content of the requirements in this AD, please contact: Cameron Balloons Limited, Telephone +44 (0)117 9637216, E-mail: technical@cameronballoons.co.uk, website: <http://www.cameronballoons.co.uk/support>.

