



適航指令發布單
Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2019-09-001	發布日期 Date issued	2019/9/5												
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	DA 42 and DA 42 M aeroplanes (including those certified in the Restricted category), all manufacturer serial numbers (MSN); and DA 42 NG and DA 42 M-NG aeroplanes (including those certified in the Restricted category), all MSN, which include those that have been converted from DA 42 and DA 42 M aeroplanes via Optional Service Bulletin (OSB) 42-068 or OSB 42-081, as applicable.														
主旨摘要	Fuel - Fuel Tank Connection Hoses - Replacement														
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authorities</div> <table style="width: 100%;"><tr><td><input type="checkbox"/> FAA</td><td><input type="checkbox"/> Germany LBA</td></tr><tr><td><input checked="" type="checkbox"/> EASA</td><td><input type="checkbox"/> CAA-NL</td></tr><tr><td><input type="checkbox"/> Brazil</td><td><input type="checkbox"/> UK CAA</td></tr><tr><td><input type="checkbox"/> Transport Canada Civil Aviation</td><td><input type="checkbox"/> Japan CAB</td></tr><tr><td><input type="checkbox"/> DGAC</td><td><input type="checkbox"/> CAA of Israel</td></tr><tr><td></td><td><input type="checkbox"/> Other _____</td></tr></table>			<input type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA	<input checked="" type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL	<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA	<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB	<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel		<input type="checkbox"/> Other _____
<input type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA														
<input checked="" type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL														
<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA														
<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB														
<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel														
	<input type="checkbox"/> Other _____														
	設計國 AD 編號 Original AD number	2019-0218													
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)														
備註 Note	ATA 28. Ref. Publications: DAI MSB 42-138 and MSB 42NG-080 (published as a single document) original issue dated 01 July 2019.														
<div>註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw</div> <div>Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw</div>															



Airworthiness Directive

AD No.: 2019-0218

Issued: 03 September 2019

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

DIAMOND AIRCRAFT INDUSTRIES GmbH

Type/Model designation(s):

DA 42 aeroplanes

Effective Date: 17 September 2019

TCDS Number(s): EASA.A.005 and EASA.A.513

Foreign AD: Not applicable

Supersedure: None

ATA 28 – Fuel – Fuel Tank Connection Hoses – Replacement

Manufacturer(s):

Diamond Aircraft Industries GmbH (Austria), Diamond Aircraft Industries Inc. (Canada)

Applicability:

DA 42 and DA 42 M aeroplanes (including those certified in the Restricted category), all manufacturer serial numbers (MSN); and

DA 42 NG and DA 42 M-NG aeroplanes (including those certified in the Restricted category), all MSN, which include those that have been converted from DA 42 and DA 42 M aeroplanes via Optional Service Bulletin (OSB) 42-068 or OSB 42-081, as applicable.

Definitions:

For the purpose of this AD, the following definitions apply:

The applicable MSB: Diamond Aircraft Industries (DAI) Mandatory Service Bulletin (MSB) 42-138 and MSB 42NG-080 (published as a single document), which includes Work Instruction WI-MSB 42-138 and WI-MSB 42NG-080.

Affected part: Fuel tank connection hoses, having Part Number (P/N) D4D-2817-10-70, as installed on the affected MSN as identified in the applicable MSB, and those as identified by invoice date, tracking number, work order and invoice number in the applicable MSB.



Serviceable part: Any fuel tank connection hose having P/N D4D-2817-10-70 that is not an affected part, and fuel tank connection hoses having P/N D4D-2817-10-70_01.

Reason:

Reports were received of dissolved fuel tank connections hoses. Rubber parts were found within the fuel tank. The investigation results showed that the affected parts are limited to 2 isolated batches, some of which were installed on the production line. Other affected parts have been supplied as spare for in-service replacement.

This condition, if not corrected, could lead to restricted fuel flow from the tank, possibly resulting in fuel starvation and consequent reduced control of the aeroplane.

To address this potential unsafe condition, DAI issued the applicable MSB, providing instructions to identify and replace the affected parts. The applicable MSB identifies the MSN of the aeroplanes on which affected parts were installed during aeroplane production. The applicable MSB also indicates that any other aeroplane may be affected, if an affected part supplied as spare was installed.

For the reason described above, this AD requires removal and replacement of the affected parts, and, if a removed affected part is found damaged, inspection of the fuel tank chambers and removal of any detached rubber material. This AD also prohibits (re)installation of any affected parts.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Replacement:

- (1) Within 100 flight hours or 4 months, whichever occurs first after the effective date of this AD, remove each affected part and replace it with a serviceable part, in accordance with the instructions of the applicable MSB.

Inspection / Corrective Action:

- (2) If, during the removal as required by paragraph (1) of this AD, a removed affected part is found damaged, before installation of the serviceable part, inspect the fuel tank chambers and remove any detached rubber material in accordance with the instructions of section III.2 of the applicable MSB.

Parts Installation:

- (3) From the effective date of this AD, do not install an affected part on any aeroplane.

Ref. Publications:

DAI MSB 42-138 and MSB 42NG-080 (published as a single document) original issue dated 01 July 2019.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.



Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 23 July 2019 as PAD 19-135 and re-published on 02 August 2019 as PAD 19-135R1 for consultation until 20 August 2019. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
5. For any question concerning the technical content of the requirements in this AD, please contact: Diamond Aircraft Industries GmbH, Austria, Telephone: +43 2622 26700, Fax: +43 2622 26780, E-mail: airworthiness@diamond-air.at.

