



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2020-02-007A	發布日期 Date issued	2020/2/27
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.		
主旨摘要	Flight Controls - Aileron, Elevator and Rudder Electro-Hydrostatic Actuators - Inspection / Replacement		
<div style="text-align: center;">民航局 CAA</div> <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authorities</div> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 50%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2020-0027R1	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	This AD revises EASA AD 2020-0027(CAA-2020-02-007) dated 14 February 2020, which superseded EASA AD 2018-0141 dated 03 July 2018.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			



Airworthiness Directive

AD No.: 2020-0027R1

Issued: 21 February 2020

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A350 aeroplanes

Effective Date: 28 February 2020 (same as original issue)

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Revision: This AD revises EASA AD 2020-0027 dated 14 February 2020, which superseded EASA AD 2018-0141 dated 03 July 2018.

ATA 27 – Flight Controls – Aileron, Elevator and Rudder Electro-Hydrostatic Actuators – Inspection / Replacement

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.

Definitions:

For the purpose of this AD, the following definitions apply:

The Airbus SB: Airbus Service Bulletin (SB) A350-27-P020.

The AOT: Airbus Alert Operators Transmission (AOT) A27P009-16.

The applicable SB: MOOG Aircraft Group SB CA67001-27-05 (aileron), SB CA67006-27-04 (elevator) and SB CA67008-27-04 (rudder), as applicable.

Affected EHA: Electro-Hydrostatic Actuators (EHA) installed on inboard ailerons, elevators and rudder, as listed by serial number in the applicable SB, except those that are paint marked, as defined in the applicable SB.



Serviceable EHA: Any EHA that is not an affected EHA.

Groups: Group 1 aeroplanes are those that have an affected EHA installed. Group 2 aeroplanes are those that do not have an affected EHA installed.

Reason:

Occurrences were reported of EHA units that were returned to the manufacturer (MOOG Aircraft Group) with degraded insulation resistance in the direct drive solenoid valve (DDSOV). Investigation results revealed that moisture ingress, due to incorrect sealing application, had caused this degradation.

This condition, if not detected and corrected, could lead to the DDSOV being unable to command or maintain the EHA in active mode, possibly resulting in reduced control of the aeroplane.

Due to similarity of design, all five EHA positions could be affected, inboard aileron EHAs (Functional Item Number (FIN) 4CR1 and FIN 4CR2), elevator EHAs (FIN 2CT1 and FIN 2CT2) and the rudder EHA (FIN 3CY). Prompted by these findings, MOOG Aircraft Group improved the manufacturing process to ensure adequate sealing capability of the DDSOV and issued the applicable SB, providing a screening procedure. To address this potential unsafe condition, Airbus issued the AOT and the Airbus SB, providing instructions to restore the EHA to nominal performance. Consequently, EASA issued AD 2018-0141 requiring a one-time insulation check of each affected EHA, and, depending on findings, accomplishment of applicable corrective action(s).

Since that AD was issued, it has been identified that EHA P/N can be modified and re-identified as specified in EASA AD 2019-0301.

For the reason stated above, EASA issued AD 2020-0027, retaining the requirements of EASA AD 2018-0141, which was superseded, and amended the definition of affected EHA.

This AD is revised to remove a wrong paragraph reference from paragraph (4) of this AD.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Initial Insulation Check:

- (1) For Group 1 aeroplanes: Within 3 months after the aeroplane has reached 700 flight hours since aeroplane first flight, or within 30 days after the effective date of this AD, whichever occurs later, accomplish an insulation check of the DDSOV of each affected EHA in accordance with the instructions of the Airbus SB.

Corrective Action(s):

- (2) If, during the insulation check as required by paragraph (1) of this AD, the measured insulation resistance is 15 MOhms or less, before next flight, replace the affected EHA with a serviceable EHA in accordance with the instructions of the Airbus SB.



- (3) If, during the insulation check as required by paragraph (1) of this AD, the measured resistance is more than 15 MOhms, within 3 months after the aeroplane has reached 36 months since aeroplane first flight, accomplish another insulation check of the DDSOV of each affected EHA in accordance with the instructions of the Airbus SB.
- (4) Depending on measured resistance result of the insulation check as required by paragraph (3) of this AD, within the applicable compliance time defined in Table 1 of this AD, accomplish the applicable corrective action(s), as defined in Table 1 of this AD in accordance with the Airbus SB, or the applicable SB.

Table 1 - Insulation Check Results and Corrective action(s)

Measured Resistance (in MOhms)	Compliance Time (since last insulation check)	Actions
15 or less	Before next flight	Replace the affected EHA with a serviceable EHA
More than 15, but not more than 50	Within 3 months	
More than 50, but not more than 100	Within 6 months	
More than 100	Before next flight	Re-identify the affected EHA (apply paint marking) as serviceable EHA

Credit:

- (5) Accomplishment of an insulation check of the DDSOV of an affected EHA, before the effective date of this AD in accordance with the instructions of the AOT, is acceptable to comply with the requirement of paragraph (1) of this AD for that affected EHA.

Reporting:

- (6) Within 30 days after each insulation check as required by paragraph (1) or (3) of this AD, as applicable, report the results (including no findings) to Airbus.

Part Installation:

- (7) For Group 1 and Group 2 aeroplanes: From the effective date AD, do not install an affected EHA on any aeroplane.

Ref. Publications:

Airbus SB A350-27-P020 original issue dated 22 February 2018, or Revision 01 dated 09 January 2019 or Revision 02 dated 13 December 2019.

Airbus AOT A27P009-16 original issue dated 15 December 2016.

MOOG INC SB CA67001-27-05 original issue dated 21 February 2018, or Revision 01 dated 14 May 2018, or Revision 02 dated 20 September 2018, or Revision 03 dated 14 September 2019.



MOOG INC SB CA67006-27-04 original issue dated 21 February 2018, or Revision 01 dated 14 May 2018, or Revision 02 dated 05 September 2018, or Revision 03 dated 14 September 2019.

MOOG INC SB CA67008-27-04 original issue dated 21 February 2018, or Revision 01 dated 14 May 2018, or Revision 02 dated 05 September 2018, or Revision 03 dated 14 September 2019.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. Based on the required actions and the compliance time, EASA have decided to issue a Final AD with Request for Comments, postponing the public consultation process until after publication.
3. Enquiries regarding this AD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
5. For any question concerning the technical content of the requirements in this AD, please contact: continued-airworthiness.a350@airbus.com.

