



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2020-02-009	發布日期 Date issued	2020/2/25
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A318-111, A318-112, A318-121, A318-122, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232 and A320-233 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 37878 has been embodied in production, or Airbus Service Bulletin (SB) A320-53-1281 has been embodied in service.		
主旨摘要	Fuselage - External Fuselage Skin - Inspection / Repair		
<div style="text-align: center;">民航局 CAA</div> <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authorities</div> <div style="display: flex; justify-content: space-between;"> <div style="width: 45%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 45%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2020-0030	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 53. This AD supersedes EASA AD 2014-0259(CAA-2014-12-001) dated 05 December 2014.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			



Airworthiness Directive

AD No.: 2020-0030

Issued: 18 February 2020

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A318, A319 and A320 aeroplanes

Effective Date: 03 March 2020

TCDS Number(s): EASA.A.064

Foreign AD: Not applicable

Supersedure: This AD supersedes EASA AD 2014-0259 dated 05 December 2014.

ATA 53 – Fuselage – External Fuselage Skin – Inspection / Repair

Manufacturer(s):

Airbus, formerly Airbus Industrie.

Applicability:

Airbus A318-111, A318-112, A318-121, A318-122, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232 and A320-233 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 37878 has been embodied in production, or Airbus Service Bulletin (SB) A320-53-1281 has been embodied in service.

Definitions:

For the purpose of this AD, the following definitions apply:

The inspection SB: Airbus SB A320-53-1287 Revision (Rev.) 01.

The modification SB: Airbus SB A320-53-1281.

Affected area: External fuselage skin panels at frame (FR) 34 underneath the fairing structure between stringer (STR) 43 left-hand (LH) side and STR43 right-hand (RH) side.

Airbus date of manufacture: The date of transfer of title (ownership) of the aeroplane which is referenced in Airbus documentation at the time of first delivery to an operator.



Reason:

An operator reported finding chafing damage in the affected area on several aeroplanes. After investigation, contact between the fairing nut plate and the fuselage was identified, causing damage to the structure of the fuselage.

This condition, if not detected and corrected, could lead to crack initiation and propagation, possibly resulting in reduced structural integrity of the fuselage.

Prompted by these findings, Airbus published the original issue of the inspection SB and EASA issued AD 2014-0259 to require repetitive detailed inspections (DET) of the affected area, and, depending on findings, accomplishment of applicable corrective action(s). That AD provided an optional terminating action for the repetitive inspections.

Since that AD was issued, Airbus issued the inspection SB, including installation process changes to ensure the electrical requirement integrity.

For the reasons described above, this AD retains the requirements of EASA AD 2014-0259, which is superseded, and requires accomplishment of the repetitive DET in accordance with the inspection SB.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection(s):

- (1) Within the compliance times as defined in the Table 1 of this AD, and, thereafter, at intervals not to exceed 24 000 flight hours (FH) or 12 000 flight cycles (FC), whichever occurs first, accomplish a DET of the affected area in accordance with the instructions of the inspection SB.

Table 1 – Inspection Threshold

Compliance Time (whichever occurs later, A or B)	
A	Before exceeding 24 000 FH or 12 000 FC, whichever occurs first since Airbus date of manufacture
B	Within 10 000 FH or 5 000 FC, whichever occurs first after 19 December 2014 [the effective date of EASA AD 2014-0259]

Corrective Action(s):

- (2) If, during any DET as required by paragraph (1) of this AD, damage is detected, before next flight, accomplish the applicable corrective action(s) in accordance with the instructions of the inspection SB or, in case the detected damage exceeds the limits specified in the inspection SB, contact Airbus for approved repair instructions and accomplish those instructions accordingly.

Credit:

- (3) Inspection(s) and corrective action(s), accomplished on an aeroplane before the effective date of this AD in accordance with the instructions of the inspection SB at original issue, are



acceptable to comply with the requirements of paragraphs (1) and (2) of this AD for that aeroplane.

Terminating Action:

- (4) Accomplishment of corrective action(s) on an aeroplane, as required by paragraph (2) of this AD, does not constitute terminating action for the repetitive inspections required by paragraph (1) of this AD for that aeroplane.
- (5) Modification of an aeroplane in accordance with the instructions of the modification SB constitutes terminating action for the repetitive inspections required by paragraph (1) of this AD for that aeroplane.

Ref. Publications:

Airbus SB A320-53-1281 original issue dated 29 July 2014, or Rev. 01 dated 01 December 2014, or Rev. 02 dated 09 October 2015, or Rev. 03 dated 03 February 2016, or Rev. 04 dated 11 March 2019.

Airbus SB A320-53-1287 original issue dated 29 July 2014, or Rev. 01 dated 04 April 2019.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

- 1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
- 2. This AD was posted on 28 November 2019 as PAD 19-208 for consultation until 26 December 2019. The Comment Response Documents can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
- 3. Enquiries regarding this AD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
- 4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
- 5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – EIAS; Fax +33 5 61 93 44 51; E-mail: account.airworth-eas@airbus.com.

