



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2020-07-001	發布日期 Date issued	2020/7/2
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes, certificated in any category		
主旨摘要	This AD requires repetitive detailed inspections and open hole high frequency eddy current (HFEC) inspections of the upper splice fittings of the bulkhead structure for cracks and applicable on-condition actions.		
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <div style="display: flex; justify-content: space-between;"> <div style="width: 48%;"> <input checked="" type="checkbox"/> FAA <input type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 48%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2020-14-02	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 53. Ref. Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			

[Federal Register Volume 85, Number 127 (Wednesday, July 1, 2020)]

[Rules and Regulations]

[Pages 39470-39471]

From the Federal Register Online via the Government Publishing Office [www.gpo.gov]

[FR Doc No: 2020-13982]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0990; Product Identifier 2019-NM-122-AD; Amendment 39-21156; AD 2020-14-02]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; correction.

SUMMARY: The FAA is correcting an airworthiness directive (AD) that published in the Federal Register. That AD applies to all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes. As published, the AD number and Amendment number specified in the preamble and regulatory text are incorrect. This document corrects that error. In all other respects, the original document remains the same.

DATES: This correction is effective July 28, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of July 28, 2020 (85 FR 37547, June 23, 2020).

ADDRESSES: For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; phone: 562-797-1717; internet: <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0990.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, any comments received, and other information. The address for Docket Operations is Docket Management Facility, U.S. Department of Transportation,

Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Eric Lin, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3523; email: eric.lin@faa.gov.

SUPPLEMENTARY INFORMATION: This AD requires repetitive detailed inspections and open hole high frequency eddy current (HFEC) inspections of the upper splice fittings for cracks and applicable on-condition actions for all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes.

Need for the Correction

As published on June 23, 2020 (85 FR 37547), the AD and Amendment numbers for this AD specified in the preamble and regulatory text are incorrect. The incorrectly specified AD number was AD 2020-12-10 and the incorrectly specified Amendment number was 39-19919; AD number AD 2020-12-10 is assigned to another AD addressing a Bell Textron Inc. helicopter unsafe condition, Amendment 39-21145 (85 FR 35555, June 11, 2020). The correct AD number for this AD is AD 2020-14-02 and the correct Amendment number is 39-21156.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020. This service information describes procedures for repetitive detailed inspections and open hole HFEC inspections of the left and right upper splice fittings for cracks and applicable on-condition actions. On-condition actions include repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Correction of Publication

This document corrects an error and correctly adds the AD as an amendment to 14 CFR 39.13. Although no other part of the preamble or regulatory information has been corrected, the FAA is publishing the entire rule in the Federal Register.

The effective date of this AD remains July 28, 2020.

Since this action only corrects the AD number and amendment number, it has no adverse economic impact and imposes no additional burden on any person. Therefore, the FAA has determined that notice and public comment procedures are unnecessary.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Correction

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39–AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Corrected]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):



2020-14-02 The Boeing Company: Amendment 39-21156; Docket No. FAA-2019-0990; Product Identifier 2019-NM-122-AD.

(a) Effective Date

This AD is effective July 28, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Unsafe Condition

This AD was prompted by reports of cracking in particular areas of the bulkhead structure at body station (BS) 2598. The FAA is issuing this AD to address fatigue cracking of the BS 2598 bulkhead structure, which could adversely affect the structural integrity of the bulkhead and the horizontal stabilizer support structure, and result in loss of controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 747-53A2899, Revision 1, dated April 7, 2020, which is referred to in Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020.

(h) Exceptions to Service Information Specifications

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020, uses the phrase “the original issue date of Requirements Bulletin 747-53A2899 RB,” this AD requires using “the effective date of this AD.”

(2) Where Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020, specifies contacting Boeing for repair instructions: This AD requires doing the repair using a method approved in accordance with the procedures specified in paragraph (j) of this AD.

(i) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Alert Requirements Bulletin 747-53A2899 RB, dated April 5, 2019.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(k) Related Information

(1) For more information about this AD, contact Eric Lin, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3523; email: eric.lin@faa.gov.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (l)(4) and (5) of this AD.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on July 28, 2020 (85 FR 37547, June 23, 2020).

(i) Boeing Alert Requirements Bulletin 747-53A2899 RB, Revision 1, dated April 7, 2020.

(ii) [Reserved]

(4) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; phone: 562-797-1717; internet: <https://www.myboeingfleet.com>.

(5) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on June 24, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-13982 Filed 6-30-20; 8:45 am]