



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2021-06-002	發布日期 Date issued	2021/6/7
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A330-201, A330-202, A330-203, A330-223, A330-243, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342, A330-343, A330-841 and A330-941 aeroplanes, all manufacturer serial numbers (MSN); and Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.		
主旨摘要	Equipment / Furnishings - Doghouse Placard - Replacement		
民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authorities <div style="display: flex; justify-content: space-between;"> <div style="width: 48%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 48%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2021-0136	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ <input type="checkbox"/>		
	2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do <input type="checkbox"/> Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 25. Ref. Publications: Airbus SB A330-25-3776 original issue dated 03 March 2021. and Airbus SB A340-25-4382 original issue dated 04 March 2021. and Airbus SB A340-25-5244 original issue dated 04 March 2021. and Bucher VSB 204XXX0-25-002 original issue dated 27 January 2021. and Diehl VSB A4-252-25-012 original issue dated 25 February 2021.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			



Airworthiness Directive

AD No.: 2021-0136

Issued: 04 June 2021

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A330 and A340 aeroplanes

Effective Date: 18 June 2021

TCDS Number(s): EASA.A.004, EASA.A.015

Foreign AD: Not applicable

Supersedure: None

ATA 25 – Equipment / Furnishings – Doghouse Placard – Replacement

Manufacturer(s):

Airbus

Applicability:

Airbus A330-201, A330-202, A330-203, A330-223, A330-243, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342, A330-343, A330-841 and A330-941 aeroplanes, all manufacturer serial numbers (MSN); and

Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.

Definitions:

For the purpose of this AD, the following definitions apply:

The SB: Airbus Service Bulletin (SB) A330-25-3776, SB A340-25-4382 and SB A340-25-5244, as applicable.

The VSB: Bucher Vendor SB (VSB) 204XXX0-25-002 and Diehl VSB A4-252-25-012, as applicable.

Affected part: Doghouses installed in the passenger cabin, as identified in the VSB, except those modified in accordance with the instructions of the SB or the VSB, as applicable.



Groups: Group 1 aeroplanes are those that have an affected part installed.
Group 2 aeroplanes are those that do not have an affected part installed.

Reason:

The door lock handling instruction of the affected part, which contains emergency equipment intended to minimise the effects of survivable accidents, is shown on a placard installed on the door close to the door lock. The current instruction given on this placard is unclear and incomplete, and could lead to incorrect operation of the doghouse door lock.

This condition, if not corrected, could lead to failure of the latch, blocking the door in the closed position and preventing access to the emergency equipment inside the affected part, possibly resulting in injury to aeroplane occupants.

To address this potential unsafe condition, correct handling instructions were developed, and Airbus published the SB, to provide instructions for in-service placard replacement.

For the reasons described above, this AD requires installation of improved handling instruction placards on each affected part, as defined in this AD. This AD also prohibits installation of an affected part on any aeroplane.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Placard Installation:

- (1) For Group 1 aeroplanes: Within 12 months after the effective date of this AD, remove the placard and install an improved handling instructions placard on each affected part in accordance with the instructions of the SB.

Part(s) Installation:

- (2) Do not install an affected part on any aeroplane, as required by paragraph (2.1) or (2.2) of this AD, as applicable.

(2.1) For Group 1 aeroplanes: After modification of the aeroplane as required by paragraph (1) of this AD.

(2.2) For Group 2 aeroplanes: From the effective date of this AD.

Ref. Publications:

Airbus SB A330-25-3776 original issue dated 03 March 2021.

Airbus SB A340-25-4382 original issue dated 04 March 2021.

Airbus SB A340-25-5244 original issue dated 04 March 2021.

Bucher VSB 204XXX0-25-002 original issue dated 27 January 2021.

Diehl VSB A4-252-25-012 original issue dated 25 February 2021.



The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was initially posted on 24 March 2021 as PAD 21-047 for consultation until 21 April 2021 and republished on 17 May 2021 as PAD 21-047R1 for additional consultation until 31 May 2021. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this PAD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – IIAL (Airworthiness Office), E-mail: airworthiness.A330-A340@airbus.com.

