



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2021-11-015	發布日期 Date issued	2021/11/24
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.		
主旨摘要	Aircraft Flight Manual - Auto Flight System Control Panel ALT Knob Button Use - Amendment \ ATA 22 - Auto Flight - Flight Control Unit - Modification		
<div style="display: flex; justify-content: space-between;"> <div style="width: 30%;"> 民航局 CAA <input type="checkbox"/> 本國產品 Native products <input type="checkbox"/> 其他個案 Other </div> <div style="width: 70%;"> 設計國民航主管機構 Original Authorities <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"><input type="checkbox"/> FAA</div> <div style="width: 50%;"><input type="checkbox"/> Germany LBA</div> <div style="width: 50%;"><input checked="" type="checkbox"/> EASA</div> <div style="width: 50%;"><input type="checkbox"/> CAA-NL</div> <div style="width: 50%;"><input type="checkbox"/> Brazil</div> <div style="width: 50%;"><input type="checkbox"/> UK CAA</div> <div style="width: 50%;"><input type="checkbox"/> Transport Canada Civil Aviation</div> <div style="width: 50%;"><input type="checkbox"/> Japan CAB</div> <div style="width: 50%;"><input type="checkbox"/> DGAC</div> <div style="width: 50%;"><input type="checkbox"/> CAA of Israel</div> <div style="width: 50%;"><input type="checkbox"/> Other _____</div> </div> </div> </div>	<div style="display: flex; justify-content: space-between;"> <div style="width: 60%;"> 設計國 AD 編號 Original AD number </div> <div style="width: 40%;">2021-0260</div> </div>		
1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ <input type="checkbox"/>			
2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do <input type="checkbox"/> Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)			
備註 Note	Ref. Publications: Airbus A350 AFM TR 121 Issue 1.0 dated 08 August 2019. Airbus SB A350-22-P016 original issue dated 24 June 2021 or Revision 01 dated 12 October 2021.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6331~3, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			



Airworthiness Directive

AD No.: 2021-0260

Issued: 18 November 2021

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A350 aeroplanes

Effective Date: 02 December 2021

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Supersedure: None

ATA – Aircraft Flight Manual – Auto Flight System Control Panel ALT Knob Button Use – Amendment

ATA 22 – Auto Flight – Flight Control Unit – Modification

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.

Definitions:

For the purpose of this AD, the following definitions apply:

The AFM TR: Airbus A350 Airplane Flight Manual (AFM) Temporary Revision (TR) 121 Issue 1.0.

The SB: Airbus Service Bulletin (SB) A350-22-P016.

Affected FCU: Flight control units (FCU), having Part Number (P/N) C31006AC01 or C31006AB01.

Serviceable FCU: FCU standard H6.0, having P/N C31006AD01.

Groups: Group 1 aeroplanes are those that have an affected FCU installed. Group 2 aeroplanes are those that do not have an affected FCU installed. An aeroplane on which Airbus modification (mod)



116233 has been embodied in production is a Group 2 aeroplane, provided the aeroplane remains in that configuration.

Reason:

Occurrences have been reported of unwanted auto flight system (AFS) altitude changes. Following investigation, it was determined that, depending on the ring selection, failure of the ALT knob on the FCU can change the target altitude, either by 100 feet or 1 000 feet. The erroneous altitude is displayed in the AFS cockpit panel display and in the primary flight display (PFD), but may not get noticed by the crew. Further investigations indicate that these events were due to an incorrect manufacturing process on the ALT knob encoder.

This condition, if not corrected, could lead to an erroneous altitude target in descent, climb or go-around, possibly resulting in an unexpected aeroplane vertical trajectory deviation, with consequent risk to the aeroplane.

To address this potential unsafe condition, Airbus published the AFM TR, as defined in this AD, providing flight crew procedures related to the use of the AFS Control Panel ALT Knob button. In addition, Airbus developed FCU standard H6.0, embodied in production through Airbus mod 116233, and published the SB to provide in-service modification instructions that, when embodied, allows removal of the applicable AFM TR.

For the reasons described above, this AD requires amendment of the applicable AFM by incorporating the AFM TR and requires replacement of the affected FCU with a serviceable FCU. This AD also allows, following that replacement, removal of the AFM TR from the applicable AFM.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

AFM Amendment:

- (1) For Group 1 aeroplanes: Within 3 months after the effective date of this AD, amend the applicable AFM by incorporating the AFM TR, as defined in this AD, inform all flight crews, and thereafter, operate the aeroplane accordingly.
- (2) For Group 1 aeroplanes: Amending the applicable AFM of an aeroplane by incorporating an AFM revision, which includes the same content as the AFM TR, is acceptable to comply with the requirements of paragraph (1) of this AD for that aeroplane.

Modification:

- (3) For Group 1 aeroplanes: Within 25 months after the effective date of this AD, replace the affected FCU with a serviceable FCU in accordance with the instructions of the SB (see Note 1 of this AD).

Note 1: The SB also provides instructions to modify an affected FCU, replacing the optical encoders, into a serviceable FCU. This AD does not mandate the FCU modification, only the replacement of the FCU with a serviceable part.



AFM Change:

- (4) For Group 1 aeroplanes: After modification of an aeroplane as required by paragraph (3) of this AD, the operational procedure of the AFM TR, as required by paragraph (1) of this AD, is no longer necessary and can be removed from the AFM of that aeroplane.

Parts Installation:

- (5) Do not install an affected FCU on any aeroplane, as required by paragraph (5.1) or (5.2) of this AD, as applicable.
- (5.1) For Group 1 aeroplanes: After modification of the aeroplane as required by paragraph (3) of this AD.
- (5.2) For Group 2 aeroplanes: From the effective date of this AD.

Ref. Publications:

Airbus A350 AFM TR 121 Issue 1.0 dated 08 August 2019.

Airbus SB A350-22-P016 original issue dated 24 June 2021 or Revision 01 dated 12 October 2021.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 01 October 2021 as PAD 21-140 for consultation until 29 October 2021. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS A350 XWB, E-mail: continued-airworthiness.a350@airbus.com.

