



## 適航指令發布單

### Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2022-06-014	發布日期 Date issued	2022/6/22
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.		
主旨摘要 Subject	Oxygen - Passenger Oxygen Masks - Replacement		
<div style="text-align: center;">民航局 CAA</div> <input type="checkbox"/> 本國產品 Native product  <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authority</div> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"> <input type="checkbox"/> FAA  <input checked="" type="checkbox"/> EASA  <input type="checkbox"/> Brazil  <input type="checkbox"/> Transport Canada Civil Aviation  <input type="checkbox"/> DGAC         </div> <div style="width: 50%;"> <input type="checkbox"/> Germany LBA  <input type="checkbox"/> CAA-NL  <input type="checkbox"/> UK CAA  <input type="checkbox"/> Japan CAB  <input type="checkbox"/> CAA of Israel  <input type="checkbox"/> Other _____         </div> </div>		
	設計國 AD 編號 Original AD number	2022-0112	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	This AD supersedes EASA AD 2020-0031(CAA-2020-02-008) dated 18 February 2020.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： <a href="mailto:adcaa@mail.caa.gov.tw">adcaa@mail.caa.gov.tw</a> Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax： (02)2545-8464, e-mail： <a href="mailto:adcaa@mail.caa.gov.tw">adcaa@mail.caa.gov.tw</a>			



## Airworthiness Directive

**AD No.:** 2022-0112

**Issued:** 17 June 2022

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

**Design Approval Holder's Name:**

AIRBUS S.A.S.

**Type/Model designation(s):**

A350 aeroplanes

**Effective Date:** 01 July 2022

**TCDS Number(s):** EASA.A.151

**Foreign AD:** Not applicable

**Supersedure:** This AD supersedes EASA AD 2020-0031 dated 18 February 2020.

### ATA 35 – Oxygen – Passenger Oxygen Masks – Replacement

**Manufacturer(s):**

Airbus S.A.S.

**Applicability:**

Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.

**Definitions:**

For the purpose of this AD, the following definitions apply:

**The SB:** Airbus Service Bulletin (SB) A350-35-P013 Revision 02, which includes reference to B/E Aerospace SB E75000-35-001 Revision 01.

**Affected part:** Emergency Passenger Oxygen Container Assemblies, having a Part Number (P/N) and Amendment (AMDT) as listed in Table 1 of this AD, and a serial number (s/n) as listed in Table 2 of this AD.

**Groups:** Group 1 aeroplanes are those that have an affected part installed. Group 2 aeroplanes are those that do not have an affected part installed.

**Aeroplane date of manufacture:** The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator, which is referenced in the Airbus documentation.



**Reason:**

On certain passenger oxygen masks, sticking effects have been observed affecting the breathing bag, after exposure to high ground temperatures of 85 degrees centigrade and above. Investigation shows that this phenomenon is limited to masks using a specific manufacturing lot of breathing bag raw material.

This condition, if not detected and corrected, could prevent the breathing bag to fully inflate, possibly resulting in injury to cabin occupants following a depressurization event.

To address this potential unsafe condition, Airbus published SB A350-35-P013 (original issue), providing instructions for the identification of affected parts, the replacement of the passenger oxygen masks, and the re-identification of the affected parts. Consequently, EASA issued AD 2020-0031 to require replacement of the passenger oxygen masks contained in the affected parts and to prohibit re-installation of affected parts.

Since that AD was issued, additional parts (Emergency Passenger Oxygen Container Assembly having s/n BEHJ-XXXX) have been identified by B/E Aerospace as affected by the same potential unsafe condition, and Airbus issued the SB, as defined in this AD.

For the reasons described above, this AD retains the requirements of EASA AD 2020-0031, which is superseded, and expands the list of affected parts.

**Required Action(s) and Compliance Time(s):**

Required as indicated, unless accomplished previously:

**Replacement:**

- (1) For Group 1 aeroplanes: Within the compliance time as defined in Table 3 of this AD, depending on aeroplane configuration, replace the passenger oxygen masks contained in each affected part and re-identify the affected part in accordance with the instructions of the SB.

Note 1: X or XXXXXXXX in Table 1 of this AD is a variable number, indicating the number of masks, and/or the mask code. N/A in Table 1 of this AD means 'No AMDT'. XXXX in Table 2 of this AD is a variable number, from 0000 to 9999.

Table 1 – Affected Parts (P/N and AMDT, see Note 1)

Affected P/N	Affected AMDT	Affected P/N	Affected AMDT	Affected P/N	Affected AMDT
EXC22XXXXXXX502	N/A	GXC22XXXXXXX501	A	HXG22XXXXXXX501	N/A
EXD44XXXXXXX501	N/A	GXD44XXXXXXX501	N/A	JXD44XXXXXXX501	N/A
FXC22XXXXXXX502	A	HXC22XXXXXXX501	A	KXC22XXXXXXX502	N/A
FXD44XXXXXXX501	N/A	HXD44XXXXXXX501	N/A	KXD44XXXXXXX501	N/A



Table 2 – Affected Parts (s/n, see Note 1)

Affected s/n			
BEFD-XXXX	BEFK-XXXX	BEHA-XXXX	BEHE-XXXX
BEFE-XXXX	BEFL-XXXX	BEHB-XXXX	BEHF-XXXX
BEFF-XXXX	BEFM-XXXX	BEHC-XXXX	BEHH-XXXX
BEFH-XXXX	BEFN-XXXX	BEHD-XXXX	BEHJ-XXXX

Table 3 – Passenger Oxygen Mask Replacement (see Note 2)

SB Embodied	Compliance Time	
Yes	A or B, whichever occurs later	
	A	Before exceeding 72 months since aeroplane date of manufacture
	B	Within 6 months after the effective date of this AD
No	Before exceeding 72 months since aeroplane date of manufacture	

Note 2: 'SB Embodied' in Table 3 of this AD indicates that Airbus SB A350-35-P013 original issue or Revision 01 has been embodied (or not, as applicable) before the effective date of this AD.

#### Parts Installation:

(2) Do not install an affected part on any aeroplane, as required by paragraph (2.1) or (2.2) of this AD, as applicable.

(2.1) For Group 1 aeroplanes: After replacement of the passenger oxygen masks contained in all affected parts on the aeroplane as required by paragraph (1) of this AD.

(2.2) For Group 2 aeroplanes: From the effective date of this AD.

#### Ref. Publications:

Airbus SB A350-35-P013 Revision 02 dated 08 March 2022.

B/E Aerospace SB E75000-35-001 Revision 01 dated 04 November 2021.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

#### Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 17 May 2022 as PAD 22-059 for consultation until 31 May 2022. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.



3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact AIRBUS S.A.S., E-mail: [continued-airworthiness.a350@airbus.com](mailto:continued-airworthiness.a350@airbus.com).

