



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2022-06-018	發布日期 Date issued	2022/6/28
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 aeroplanes, all manufacturer serial numbers (MSN), except those on which Airbus modification (mod) 116392 has been embodied in production; and Airbus A350-1041 aeroplanes, all MSN, except those on which Airbus mod 116393 has been embodied in production.		
主旨摘要 Subject	Air Conditioning - Forward Cargo Compartment Bracket Surface Protection - Modification		
<div style="text-align: center;">民航局 CAA</div> <input type="checkbox"/> 本國產品 Native product <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authority</div> <div style="display: flex; justify-content: space-between;"> <div style="width: 45%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 45%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number	2022-0119	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 21. Ref. Publications: Airbus SB A350-21-P031 Revision 01 dated 15 February 2022. and Airbus SB A350-21-P032 Revision 01 dated 02 March 2022. and Airbus SB A350-21-P044 original issue dated 15 February 2022.		
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax： (02)2545-8464, e-mail： adcaa@mail.caa.gov.tw			

CAA Form ACS-P08-02

第一頁/共一頁



Airworthiness Directive

AD No.: 2022-0119

Issued: 21 June 2022

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS S.A.S.

Type/Model designation(s):

A350 aeroplanes

Effective Date: 05 July 2022

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Supersedure: None

ATA 21 – Air Conditioning – Forward Cargo Compartment Bracket Surface Protection – Modification

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 aeroplanes, all manufacturer serial numbers (MSN), except those on which Airbus modification (mod) 116392 has been embodied in production; and

Airbus A350-1041 aeroplanes, all MSN, except those on which Airbus mod 116393 has been embodied in production.

Definitions:

For the purpose of this AD, the following definitions apply:

Affected part: For A350-1041 aeroplanes, aluminium bracket installed on titanium strut at frame (FR) 22 in zone C2-2 forward section; for A350-941 aeroplanes, aluminium bracket installed on carbon fibre reinforced plastic (CFRP) strut at FR22 and FR24 in zone C2-2 forward section.

Groups: Group 1 aeroplanes are those on which Airbus mod 109229 or mod 109230 has been embodied in production. Group 2 aeroplanes are those on which Airbus Service Bulletin (SB)



A350-21-P031 at original issue or SB A350-21-P032 at original issue has been accomplished in service. Group 3 aeroplanes are those that are neither Group 1 nor Group 2.

Aeroplane date of manufacture: The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator, which is referenced in Airbus documentation.

Reason:

It has been identified that, on certain aeroplanes, the surface protection of the affected part, as defined in this AD, is missing. These affected parts were embodied in production through mod 109229 (on A350-1041 aeroplanes) and mod 109230 (on A350-941 aeroplanes), and in service through SB A350-21-P031 (for A350-1041 aeroplanes) and SB A350-21-P032 (for A350-941 aeroplanes), both at original issue.

This condition, if not corrected, could lead to rupture of the ducting, reducing the efficiency of the cockpit air distribution system, which, in combination with smoke in the cockpit, could possibly result in impaired flight crew capability to control the aeroplane.

To address this potential unsafe condition, Airbus designed mod 116392 and mod 116393, introducing surface protection, and additionally revised SB A350-21-P031 and SB A350-21-P032 and issued SB A350-21-P044 to provide modification instructions.

For the reasons described above, this AD requires application of surface protection on the affected part.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Modification:

- (1) For Group 1 aeroplanes: Before exceeding 78 months since aeroplane date of manufacture, apply surface protection on the affected part in accordance with the instructions of Airbus SB A350-21-P044.

Additional Work:

- (2) For Group 2 aeroplanes: Before exceeding 72 months since embodiment of Airbus SB A350-21-P031 or SB A350-21-P032 (both at original issue), as applicable, accomplish the actions identified as 'additional work' in, and in accordance with the instructions of, Airbus SB A350-21-P031 Revision 01 or SB A350-21-P032 Revision 01, as applicable.
- (3) For Group 3 aeroplanes: From the effective date of this AD, do not modify any aeroplane in accordance with the instructions of Airbus SB A350-21-P031 at original issue or SB A350-21-P032 at original issue.

Ref. Publications:

Airbus SB A350-21-P031 Revision 01 dated 15 February 2022.

Airbus SB A350-21-P032 Revision 01 dated 02 March 2022.



Airbus SB A350-21-P044 original issue dated 15 February 2022.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 10 May 2022 as PAD 22-053 for consultation until 07 June 2022. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS A350 XWB, E-mail: continued-airworthiness.a350@airbus.com.

