



**適航指令發布單**  
**Airworthiness Directive Issuance Form**

民航局 AD 編號 AD number	CAA-2022-09-001	發布日期 Date issued	2022/9/13												
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A319-151N, A319-153N, A319-171N, A320-251N, A320-252N, A320-253N, A320-271N, A320-272N, A320-273N, A321-251N, A321-251NX, A321-252N, A321-252NX, A321-253N, A321-253NX, A321-271N, A321-271NX, A321-272N and A321-272NX aeroplanes, all manufacturer serial numbers (MSN), except those on which Airbus modification (mod) 167036 has been embodied in production.														
主旨摘要 Subject	Fuel - Engine Low Pressure Shut Off Valve Electrical Harness Routing - Modification														
民航局 CAA <input type="checkbox"/> 本國產品 Native product  <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authority <table border="0"><tr><td><input type="checkbox"/> FAA</td><td><input type="checkbox"/> Germany LBA</td></tr><tr><td><input checked="" type="checkbox"/> EASA</td><td><input type="checkbox"/> CAA-NL</td></tr><tr><td><input type="checkbox"/> Brazil</td><td><input type="checkbox"/> UK CAA</td></tr><tr><td><input type="checkbox"/> Transport Canada Civil Aviation</td><td><input type="checkbox"/> Japan CAB</td></tr><tr><td><input type="checkbox"/> DGAC</td><td><input type="checkbox"/> CAA of Israel</td></tr><tr><td></td><td><input type="checkbox"/> Other _____</td></tr></table>			<input type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA	<input checked="" type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL	<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA	<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB	<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel		<input type="checkbox"/> Other _____
<input type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA														
<input checked="" type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL														
<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA														
<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB														
<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel														
	<input type="checkbox"/> Other _____														
	設計國 AD 編號 Original AD number	2022-0185													
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____														
	2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)														
備註 Note	ATA 28. Ref. Publications: Airbus SB A320-92-1144 original issue dated 04 March 2022. and Airbus SB A320-92-1145 original issue dated 17 May 2022.														
註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： <a href="mailto:adcaa@mail.caa.gov.tw">adcaa@mail.caa.gov.tw</a> Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： <a href="mailto:adcaa@mail.caa.gov.tw">adcaa@mail.caa.gov.tw</a>															



## Airworthiness Directive

**AD No.:** 2022-0185

**Issued:** 05 September 2022

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

### Design Approval Holder's Name:

AIRBUS S.A.S.

### Type/Model designation(s):

A319, A320 and A321 aeroplanes

**Effective Date:** 19 September 2022

**TCDS Number(s):** EASA.A.064

**Foreign AD:** Not applicable

**Supersedure:** None

## ATA 28 – Fuel – Engine Low Pressure Shut Off Valve Electrical Harness Routing – Modification

### Manufacturer(s):

Airbus

### Applicability:

Airbus A319-151N, A319-153N, A319-171N, A320-251N, A320-252N, A320-253N, A320-271N, A320-272N, A320-273N, A321-251N, A321-251NX, A321-252N, A321-252NX, A321-253N, A321-253NX, A321-271N, A321-271NX, A321-272N and A321-272NX aeroplanes, all manufacturer serial numbers (MSN), except those on which Airbus modification (mod) 167036 has been embodied in production.

### Definitions:

For the purpose of this AD, the following definitions apply:

**The SB:** Airbus Service Bulletin (SB) A320-92-1144 (for MSN with International Aero Engines PW1100 series engines) and SB A320-92-1145 (for MSN with CFM International LEAP-1A series engines), as applicable.

**Aeroplane date of manufacture:** The date of transfer of title (ownership) which is referenced in Airbus documentation at the time of first delivery to an operator.



**Reason:**

During a safety review of the aeroplane fuel system, it was identified that the electrical harness routing of the engine low pressure shut off valve (LPSOV) is not adequately protected against Uncontained Engine Rotor Failure (UERF).

This condition, if not corrected, could lead to potential loss of engine fuel isolation capability in case of UERF, possibly resulting in an uncontrolled fire.

To address this potential unsafe condition, Airbus developed mod 167036, embodied on the production line, and issued the SB to provide in-service modification instructions.

For the reasons described above, this AD requires modification of the LPSOV electrical harness routing on either the left-hand engine (LEAP-1A series engines installed) or the right-hand engine (PW1100 series engines installed), as applicable.

**Required Action(s) and Compliance Time(s):**

Required as indicated, unless accomplished previously:

**Modification(s):**

Before exceeding 7 years since aeroplane date of manufacture, or within 12 months after the effective date of this AD, whichever occurs later, modify the routing of the LPSOV electrical harness in accordance with the instructions of the SB, or contact Airbus for approved instructions whenever necessary and, within the compliance time specified therein, accomplish those instructions accordingly.

**Ref. Publications:**

Airbus SB A320-92-1144 original issue dated 04 March 2022.

Airbus SB A320-92-1145 original issue dated 17 May 2022.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

**Remarks:**

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 22 July 2022 as PAD 22-098 for consultation until 19 August 2022. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety](#)



[reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.

5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – 1IASA; E-mail: [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com).

