



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2023-01-012	發布日期 Date issued	2023/2/2
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	This AD applies to Gulfstream Aerospace Corporation Model GV and GV-SP airplanes, all serialnumbers, certificated in any category. Note 1 to paragraph (c): Model GV-SP airplanes are also referred to by the market ingdesignations G500, G550, and G500-5000.		
主旨摘要 Subject	This AD requires revising the ALS of the existing instructions for continued airworthiness or inspection program for the airplane to establish a life limit for the affected MLG trunnion pin.		
民航局 CAA <input type="checkbox"/> 本國產品 Native product <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authority <div style="display: flex; justify-content: space-between;"> <div style="width: 48%;"> <input checked="" type="checkbox"/> FAA <input type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 48%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div>		
	設計國 AD 編號 Original AD number		2023-02-02
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	None		

註： 1. AD 內容後附。
 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。
 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail：adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.
 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.
 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail：adcaa@mail.caa.gov.tw

[Federal Register, Volume 88 Number 15 (Tuesday, January 24, 2023)]
[Rules and Regulations]
[Pages 4080-4081]
From the Federal Register Online via the Government Publishing Office [www.gpo.gov]
[FR Doc No: 2023-01164]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1305; Project Identifier AD-2022-00913-T; Amendment 39-22309; AD 2023-02-02]

RIN 2120-AA64

Airworthiness Directives; Gulfstream Aerospace Corporation Airplanes

AGENCY:

Federal Aviation Administration (FAA), DOT.

ACTION:

Final rule.

SUMMARY:

The FAA is adopting a new airworthiness directive (AD) for all Gulfstream Aerospace Corporation (Gulfstream) Model GV and GV-SP airplanes. This AD was prompted by the omission of a life limit in the airworthiness limitations section (ALS) of the maintenance manual for a certain main landing gear (MLG) trunnion pin. This AD requires revising the ALS of the existing instructions for continued airworthiness (ICA) or inspection program for the airplane to establish a life limit for the affected MLG trunnion pin. The FAA is issuing this AD to address the unsafe condition on these products.

DATES:

This AD is effective February 28, 2023.

ADDRESSES:

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2022-1305; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Miral Patel, Aerospace Engineer, Systems and Equipment Section, FAA, Atlanta ACO Branch, 1701 Columbia Avenue, College Park, GA 30337; phone: 404-474-5590; email: 9-ASO-ATLACO-ADs@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend [14 CFR part 39](#) by adding an AD that would apply to all Gulfstream Model GV and GV-SP airplanes. The NPRM published in the **Federal Register** on October 27, 2022 ([87 FR 65018](#)). The NPRM was prompted by a report indicating a life limit for replacing MLG trunnion pin part number (P/N) 1159SCL566-17 had been omitted from the ALS of the maintenance manual for Model GV and GV-SP airplanes. Gulfstream revised the ALS for the applicable airplanes to establish a life limit of 20,000 flight cycles for the affected MLG trunnion pin. A trunnion pin remaining in service beyond its life limit could lead to fracture and failure of the trunnion pin. This condition, if not addressed, could result in MLG failure and could lead to a runway excursion.

Discussion of Final Airworthiness Directive

Comments

The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Other Related Service Information

The FAA reviewed Gulfstream GV Aircraft Maintenance Manual, Revision 55, dated March 15, 2022; Gulfstream G550 Aircraft Maintenance Manual, Revision 36, dated March 15, 2022; and Gulfstream G500-5000 Aircraft Maintenance Manual, Revision 36, dated March 15, 2022. The service information adds a life limit for MLG trunnion pin P/N 1159SCL566-17.

Costs of Compliance

The FAA estimates that this AD affects 582 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

Estimated Costs

Action	Labor cost	Parts cost	Cost/airplane	Cost on U.S. operators
--------	------------	------------	---------------	------------------------

Action	Labor cost	Parts cost	Cost/airplane	Cost on U.S. operators
Revise ALS	1 work-hour × \$85 = \$85	N/A	\$85	\$49,470

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under [Executive Order 13132](#). This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in [14 CFR Part 39](#)

- Air transportation
- Aircraft
- Aviation safety
- Incorporation by reference
- Safety

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends [14 CFR part 39](#) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: [49 U.S.C. 106\(g\)](#), [40113](#), [44701](#).

[§.39.13](#) [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2023-02-02 Gulfstream Aerospace Corporation: Amendment 39-22309; Docket No. FAA-2022-1305; Project Identifier AD-2022-00913-T.

(a) Effective Date

This airworthiness directive (AD) is effective February 28, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Gulfstream Aerospace Corporation Model GV and GV-SP airplanes, all serial numbers, certificated in any category.

Note 1 to paragraph (c): Model GV-SP airplanes are also referred to by the marketing designations G500, G550, and G500-5000.

(d) Subject

Joint Aircraft System Component (JASC) Code 3200, Landing Gear System.

(e) Unsafe Condition

This AD was prompted by the omission of a life limit in the airworthiness limitations section (ALS) for a certain main landing gear (MLG) trunnion pin. The FAA is issuing this AD to prevent a MLG trunnion pin from remaining in service beyond its life limit. This unsafe condition, if not addressed, could result in MLG failure and could lead to a runway excursion.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Incorporation of ALS Revisions

Within 12 months after the effective date of this AD, revise the existing ALS of the instructions for continued airworthiness or aircraft inspection program for your airplane by establishing a life limit of 20,000 flight cycles for each MLG trunnion pin part number (P/N) 1159SCL566-17.

Note 2 to paragraph (g): The life limit in paragraph (g) of this AD is contained in table 5 in Section 05-10-10 of the Gulfstream V Aircraft Maintenance Manual, Revision 55, dated March 15, 2022; table 4 in Section 05-10-10 of the Gulfstream G500-5000 Aircraft Maintenance Manual, Revision 36, dated March 15, 2022; and table 4 in Section 05-10-10 of the Gulfstream G550 Aircraft Maintenance Manual, Revision 36, dated March 15, 2022.

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Atlanta ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in [14 CFR 39.19](#). In accordance with [14 CFR 39.19](#), send your

request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (i)(1) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(i) Related Information

(1) For more information about this AD, contact Miral Patel, Aerospace Engineer, Systems and Equipment Section, FAA, Atlanta ACO Branch, 1701 Columbia Avenue, College Park, GA 30337; phone: 404-474-5590; email: 9-ASO-ATLACO-ADs@faa.gov.

(2) For service information identified in this AD that is not incorporated by reference, contact Gulfstream Aerospace Corporation, Technical Publications Dept., P.O. Box 2206, Savannah, GA 31402-2206; phone: (800) 810-4853; email: pubs@gulfstream.com; website: gulfstream.com/en/customer-support/. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(j) Material Incorporated by Reference

None.

Issued on January 18, 2023.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[[FR Doc. 2023-01164](#) Filed 1-23-23; 8:45 am]

BILLING CODE 4910-13-P