



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2023-03-004	發布日期 Date issued	2023/3/16
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 aeroplanes, manufacturer serial numbers (MSN) as listed in the SB, as defined in this AD.		
主旨摘要 Subject	Doors - Main Landing Gear Doors / Axis Index Washer - Inspection		
<div style="display: flex; justify-content: space-between;"> <div style="width: 30%;"> 民航局 CAA <input type="checkbox"/> 本國產品 Native product <input type="checkbox"/> 其他個案 Other </div> <div style="width: 70%;"> 設計國民航主管機構 Original Authority <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"> <input type="checkbox"/> FAA <input checked="" type="checkbox"/> EASA <input type="checkbox"/> Brazil <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> DGAC </div> <div style="width: 50%;"> <input type="checkbox"/> Germany LBA <input type="checkbox"/> CAA-NL <input type="checkbox"/> UK CAA <input type="checkbox"/> Japan CAB <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____ </div> </div> </div> </div>	<div style="display: flex; justify-content: space-between;"> <div style="width: 60%;"> 設計國 AD 編號 Original AD number </div> <div style="width: 40%;"> 2023-0051 </div> </div>		
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 52. Ref. Publications: Airbus SB A350-52-P048 original issue dated 24 November 2022.		

註： 1. AD 內容後附。
 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。
 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail：adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.
 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.
 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail：adcaa@mail.caa.gov.tw



Airworthiness Directive

AD No.: 2023-0051

Issued: 10 March 2023

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS S.A.S.

Type/Model designation(s):

A350 aeroplanes

Effective Date: 24 March 2023

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Supersedure: None

ATA 52 – Doors – Main Landing Gear Doors / Axis Index Washer – Inspection

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 aeroplanes, manufacturer serial numbers (MSN) as listed in the SB, as defined in this AD.

Definitions:

For the purpose of this AD, the following definitions apply:

The SB: Airbus Service Bulletin (SB) A350-52-P048.

Affected part: Axis index washer on right-hand and left-hand main landing gear door (MLGD) hinge.

Aeroplane date of manufacture: The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator, which is referenced in Airbus documentation.

Groups: Group 1 aeroplanes are those having MSN identified as "Configuration 001" in the SB. Group 2 aeroplanes are those having MSN identified as "Configuration 002" in the SB.

Reason:

Index washers at MLGD hinges #1 (forward) and #3 (rear) were found inverted in production on A350-941 aeroplanes (index washer for forward fitting installed at rear fitting and vice versa).

This condition, if not detected and corrected, could lead to reduced structural integrity of the MLGD hinge fittings, possibly resulting in in-flight loss of a MLGD, and consequent injury to persons on the ground.

To address this potential unsafe condition, Airbus issued the SB to provide inspection and replacement instructions of the affected parts.

For the reasons described above, this AD requires a one-time detailed inspection (DET) of each affected part and, depending on findings, replacement.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection:

- (1) Within the compliance time specified in Table 1 of this AD, as applicable, accomplish a DET of each affected part in accordance with the instructions of the SB.

Table 1 – Inspection

Group	Compliance Time (since aeroplane date of manufacture)
1	Before exceeding 9 600 flight cycles (FC) or 46 900 flight hours (FH), whichever occurs first.
2	Before exceeding 16 800 FC or 82 750 FH, whichever occurs first.

Corrective Action:

- (2) If, during the DET as required by paragraph (1) of this AD, any affected part is found not correctly installed as specified in the SB, within 500 FC or 3 500 FH, whichever occurs first after the DET as required by paragraph (1) of this AD, replace that affected part in accordance with the instructions of the SB.

Ref. Publications:

Airbus SB A350-52-P048 original issue dated 24 November 2022.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.

2. This AD was posted on 26 January 2023 as PAD 23-011 for consultation until 23 February 2023. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS S.A.S. A350 XWB (1IAK), E-mail: continued-airworthiness.a350@airbus.com.