



適航指令發布單

Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2023-05-009	發布日期 Date issued	2023/5/30
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	This AD applies to The Boeing Company airplanes (1) Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, as identified in Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022.(2) Model 737-8 and -9 airplanes, as identified in Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022.		
主旨摘要 Subject	This AD requires inspecting all escape slide assemblies to identify affected parts, and applicable on-condition actions.		
民航局 CAA <input type="checkbox"/> 本國產品 Native product <input type="checkbox"/> 其他個案 Other	設計國民航主管機構 Original Authority <input checked="" type="checkbox"/> FAA <input type="checkbox"/> Germany LBA <input type="checkbox"/> EASA <input type="checkbox"/> CAA-NL <input type="checkbox"/> Brazil <input type="checkbox"/> UK CAA <input type="checkbox"/> Transport Canada Civil Aviation <input type="checkbox"/> Japan CAB <input type="checkbox"/> DGAC <input type="checkbox"/> CAA of Israel <input type="checkbox"/> Other _____		
	設計國 AD 編號 Original AD number	2023-09-04	
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____		
	2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)		
備註 Note	ATA 25. Ref. Boeing Special Attention Requirements Bulletin 737 - 25 - 1855 RB, Revision 1, dated April 13, 2022. and Boeing Special Attention Requirements Bulletin 737 - 25 - 1866 RB, Revision 1, dated April 11, 2022.		
註 :	1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw		
Note :	1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw		

[Federal Register, Volume 88 Number 101 (Thursday, May 25, 2023)]
[Rules and Regulations]
[Pages 33817-33820]
From the Federal Register Online via the Government Publishing Office [www.gpo.gov]
[FR Doc No: 2023-11085]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1410; Project Identifier AD-2022-00198-T; Amendment 39-22427; AD 2023-09-04]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY:

Federal Aviation Administration (FAA), DOT.

ACTION:

Final rule.

SUMMARY:

The FAA is adopting a new airworthiness directive (AD) for certain The Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, and certain Model 737-8 and -9 airplanes. This AD was prompted by reports of uncommanded escape slide deployments in the passenger compartment, caused by too much tension in the inflation cable and the movement of the escape slide assembly in the escape slide compartment. This AD requires inspecting all escape slide assemblies to identify affected parts, and applicable on-condition actions. The FAA is issuing this AD to address the unsafe condition on these products.

DATES:

This AD is effective June 29, 2023.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of June 29, 2023.

ADDRESSES:

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2022-1410; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket

Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website *myboeingfleet.com*.
- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at *regulations.gov* under Docket No. FAA-2022-1410.

FOR FURTHER INFORMATION CONTACT:

Brandon Lucero, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3569; email: brandon.lucero@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend [14 CFR part 39](#) by adding an AD that would apply to certain The Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, and certain Model 737-8 and -9 airplanes. The NPRM published in the **Federal Register** on November 30, 2022 ([87 FR 73507](#)). The NPRM was prompted by reports from Boeing of uncommanded escape slide deployments in the passenger compartment while the airplane was on the ground, caused by too much tension in the inflation cable (introduced during packing of the slide) and the movement of the escape slide assembly in the escape slide compartment during normal airplane operations. The escape slide is used in the door-mounted escape system of the forward and aft entry doors, and the forward and aft galley service doors on the affected airplanes. In the NPRM, the FAA proposed to require inspecting all escape slide assemblies to identify affected parts, and applicable on-condition actions. The FAA is issuing this AD to address inflation of the escape slide while it is in the escape slide compartment, which could result in injury to passengers and crew during normal operation, or impede an emergency evacuation by rendering the exit unusable.

Discussion of Final Airworthiness Directive

Comments

The FAA received a comment from The Air Line Pilots Association, International (ALPA) and an individual, who supported the NPRM without change.

The FAA received additional comments from Aviation Partners Boeing, AIRDO, Singapore Airlines (SIA), American Airlines (AAL), Southwest Airlines (SWA), and an individual. The following presents the comments received on the NPRM and the FAA's response to each comment.

Effect of Winglets on Accomplishment of the Proposed Actions

Aviation Partners Boeing stated that the installation of winglets per Supplemental Type Certificate STC ST00830SE does not affect the accomplishment of the actions in the proposed AD.

The FAA agrees with the commenter that the installation of STC ST00830SE does not affect the ability to accomplish the actions required by this AD. The FAA has not changed this AD in this regard.

Request To Allow Maintenance Records Review To Determine Slide Part Numbers

AIRDO, SIA, and SWA requested the proposed AD be revised to allow using maintenance records in lieu of inspecting the part number of the escape slide assembly as required by the service information specified in paragraph (g) of the proposed AD. SWA noted that escape slides are time limited parts and can easily be identified by a maintenance records review. AIRDO added that the escape slide is controlled by the operator's maintenance system, so it will be easier to use a maintenance record to identify the part number.

The FAA agrees to allow for a maintenance record review to determine the part number of the escape slide assembly, provided the part number can be conclusively determined from the records review. The FAA has added paragraph (h)(3) of this AD to allow a records review in lieu of an inspection.

Request To Add a Parts Prohibition Paragraph

AAL suggested adding a parts prohibition paragraph to the proposed AD. AAL noted that the proposed AD, Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022, and Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022, do not explicitly prohibit the installation of slide P/N 5A3307-7 after the actions have been accomplished. AAL requested that the FAA add a paragraph prohibiting the installation of an escape slide part number (P/N) 5A3307-7 after the actions in paragraph (g) of the proposed AD have been accomplished.

The FAA agrees to clarify. [14 CFR 39.7](#) specifies that once an AD is issued, no person may operate a product to which the AD applies except in accordance with the requirements of that AD. Further, [14 CFR 39.9](#) imposes a continuing obligation to maintain compliance with an AD by establishing a separate violation for each time an aircraft is operated that fails to meet AD requirements. Thus, operators have an ongoing obligation to ensure that the AD-mandated configuration is maintained. The FAA has not changed this AD as a result of the request.

Request To Add Information Notice 737-25-1855 IN 01

SIA requested Boeing Information Notice 737-25-1855 IN 01, dated April 22, 2022, to be referenced along with Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022. SIA noted that Boeing Information Notice 737-25-1855 IN 01, dated April 22, 2022, changed the weight and balance information to "none."

The FAA disagrees with the commenter's request. The weight and balance information is only contained in Boeing Special Attention Service Bulletin 737-25-1855, Revision 1, dated April 13, 2022, and is not required for compliance with this AD. Additionally, the information in Boeing

Information Notice 737-25-1855 IN 01, dated April 22, 2022, is not necessary to address the unsafe condition or comply with this AD. The FAA has not changed this AD regarding this issue.

Request To Add Airplanes of Similar Type Design

An individual requested the FAA require inspecting other aircraft of similar type design. The individual expressed concern that an emergency evacuation would render the exit unusable.

The FAA agrees to clarify. An emergency evacuation slide is often designed for a particular aircraft. In this case, the escape slide assembly in question is a unique installation to the 737, and the same design does not exist on other aircraft. Therefore, no change to this AD is necessary.

Conclusion

The FAA reviewed the relevant data, considered any comments received, and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, and any other changes described previously, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Related Service Information Under [1 CFR Part 51](#)

The FAA reviewed Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022, and Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022. This service information specifies procedures for inspecting all escape slide assemblies to identify affected parts, and applicable on-condition actions. The on-condition actions include replacing any escape slide assembly having part number (P/N) 5A3307-7 with a new assembly having P/N 5A3307-9 or P/N 5A3307-701 (an escape slide assembly having P/N 5A3307-701 is one on which a firing cable retention modification has been done and the assembly has been reidentified). These documents are distinct since they apply to different airplane models.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES** .

Costs of Compliance

The FAA estimates that this AD affects 2,502 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

Estimated Costs

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection or maintenance records review	2 work-hours × \$85 per hour = \$85	\$0	\$170	\$425,340

The FAA estimates the following costs to do any necessary replacements that would be required based on the results of the inspection. The agency has no way of determining the number of aircraft that might need these replacements:

On-Condition Costs

Action	Labor cost	Parts cost	Cost per product
Replacement	Up to 1 work hours × \$85 per hour = up to \$85	Up to \$19,000	Up to \$19,085 per escape slide assembly.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under [Executive Order 13132](#). This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in [14 CFR Part 39](#)

- Air transportation
- Aircraft
- Aviation safety
- Incorporation by reference
- Safety

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends [14 CFR part 39](#) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: [49 U.S.C. 106\(g\)](#), [40113](#), [44701](#).

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2023–09–04 The Boeing Company: Amendment 39–22427; Docket No. FAA–2022–1410; Project Identifier AD–2022–00198–T.

(a) Effective Date

This airworthiness directive (AD) is effective June 29, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company airplanes identified in paragraphs (c)(1) and (2) of this AD.

(1) Model 737–600, –700, –700C, –800, –900, and –900ER series airplanes, as identified in Boeing Special Attention Requirements Bulletin 737–25–1855 RB, Revision 1, dated April 13, 2022.

(2) Model 737–8 and –9 airplanes, as identified in Boeing Special Attention Requirements Bulletin 737–25–1866 RB, Revision 1, dated April 11, 2022.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by reports of uncommanded escape slide deployments in the passenger compartment, caused by too much tension in the inflation cable and the movement of the escape slide assembly in the escape slide compartment. The FAA is issuing this AD to address inflation of the escape slide while it is in the escape slide compartment, which could result in injury to passengers and crew during normal operation, or impede an emergency evacuation by rendering the exit unusable.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Special Attention Requirements Bulletin 737–25–1855 RB,

Revision 1, dated April 13, 2022, and Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022 (for Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes), and Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022 (for Model 737-8 and -9 airplanes); as applicable.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Special Attention Service Bulletin 737-25-1855, Revision 1, dated April 13, 2022, which is referred to in Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022.

Note 2 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Special Attention Service Bulletin 737-25-1866, Revision 1, dated April 11, 2022, which is referred to in Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022.

(h) Exceptions to Service Information Specifications

(1) Where the Compliance Time columns of the tables in the “Compliance” paragraph of Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022, use the phrase “the Original Issue date of Requirements Bulletin 737-25-1855 RB,” this AD requires using “the effective date of this AD.”

(2) Where the Compliance Time columns of the tables in the “Compliance” paragraph of Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022, use the phrase “the Original Issue date of Requirements Bulletin 737-25-1866 RB,” this AD requires using “the effective date of this AD.”

(3) Where Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022, and Boeing Special Attention Requirements Bulletin 737-25-1866 RB specify doing an inspection of the escape slide assembly to determine whether P/N 5A3307-7 is installed, for this AD a review of airplane maintenance records is acceptable in lieu of this inspection, provided the part number of the escape slide assembly can be conclusively determined from that review.

(i) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Special Attention Requirements Bulletin 737-25-1855 RB, dated August 31, 2021, or Boeing Special Attention Requirements Bulletin 737-25-1866 RB, dated September 27, 2021, as applicable.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in [14 CFR 39.19](#). In accordance with [14 CFR 39.19](#), send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(k) Related Information

For more information about this AD, contact Brandon Lucero, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3569; email: brandon.lucero@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under [5 U.S.C. 552\(a\)](#) and [1 CFR part 51](#).

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Special Attention Requirements Bulletin 737-25-1855 RB, Revision 1, dated April 13, 2022.

(ii) Boeing Special Attention Requirements Bulletin 737-25-1866 RB, Revision 1, dated April 11, 2022.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on April 28, 2023.

Gaetano A. Sciortino,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023-11085 Filed 5-24-23; 8:45 am]

BILLING CODE 4910-13-P