



適航指令發布單
Airworthiness Directive Issuance Form

民航局 AD 編號 AD number	CAA-2023-06-006	發布日期 Date issued	2023/6/28												
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	This AD applies to all The Boeing Company Model 747 – 100, 747 – 100B, 747 – 100B SUD, 747 – 200B, 747 – 200C, 747 – 200F, 747 – 300, 747 – 400, 747 – 400D, and 747 – 400F series airplanes, certificated in any category.														
主旨摘要 Subject	This AD requires revising the limitations section of the existing AFM to incorporate limitations requiring specific operating procedures, and retains the operating procedures for takeoff, ILS approaches, non-precision approaches, and go-around and mi														
民航局 CAA <input type="checkbox"/> 本國產品 Native product <input type="checkbox"/> 其他個案 Other	<div style="text-align: center;">設計國民航主管機構 Original Authority</div> <table style="width: 100%;"><tr><td><input checked="" type="checkbox"/> FAA</td><td><input type="checkbox"/> Germany LBA</td></tr><tr><td><input type="checkbox"/> EASA</td><td><input type="checkbox"/> CAA-NL</td></tr><tr><td><input type="checkbox"/> Brazil</td><td><input type="checkbox"/> UK CAA</td></tr><tr><td><input type="checkbox"/> Transport Canada Civil Aviation</td><td><input type="checkbox"/> Japan CAB</td></tr><tr><td><input type="checkbox"/> DGAC</td><td><input type="checkbox"/> CAA of Israel</td></tr><tr><td colspan="2"><input type="checkbox"/> Other _____</td></tr></table>			<input checked="" type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA	<input type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL	<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA	<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB	<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel	<input type="checkbox"/> Other _____	
<input checked="" type="checkbox"/> FAA	<input type="checkbox"/> Germany LBA														
<input type="checkbox"/> EASA	<input type="checkbox"/> CAA-NL														
<input type="checkbox"/> Brazil	<input type="checkbox"/> UK CAA														
<input type="checkbox"/> Transport Canada Civil Aviation	<input type="checkbox"/> Japan CAB														
<input type="checkbox"/> DGAC	<input type="checkbox"/> CAA of Israel														
<input type="checkbox"/> Other _____															
	設計國 AD 編號 Original AD number	2023-12-14													
	1. 直接採用原 AD 之內容?(Is the original AD directly adopted?) <input checked="" type="checkbox"/> 是(Yes) <input type="checkbox"/> 否(No) _ a. 生效日期另訂為(Re-specify the effective date as) : _____ b. 執行時限另訂為(Re-specify the compliance time or period as) : _____ 2. 使用人是否需要將 AD 執行結果向民航局提出報告?(Do Users need to report the status of compliance to the CAA?) <input type="checkbox"/> 是(Yes) <input checked="" type="checkbox"/> 否(No)														
備註 Note	This AD replaces AD 2022-06-16(CAA-2023-03-015)														
<div>註： 1. AD 內容後附。 2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。 3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, e-mail： adcaa@mail.caa.gov.tw</div> <div>Note： 1. The AD text is enclosed. 2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval. 3. For further information, please contact Civil Aeronautics Administration on Tel：(02)2349-6330 / 6332, Fax： (02)2545-8464, e-mail：adcaa@mail.caa.gov.tw</div>															

[Federal Register, Volume 88 Number 118 (Wednesday, June 21, 2023)]

[Rules and Regulations]

[Pages 40003-40010]

From the Federal Register Online via the Government Publishing Office [www.gpo.gov]

[FR Doc No: 2023-13149]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2023–0922; Project Identifier AD–2022–01431–T; Amendment 39–22472; AD 2023–12–14]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY:

Federal Aviation Administration (FAA), DOT.

ACTION:

Final rule.

SUMMARY:

The FAA is superseding Airworthiness Directive (AD) 2022–06–16, which applied to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, and 747–400F series airplanes. AD 2022–06–16 required revising the limitations and operating procedures sections of the existing airplane flight manual (AFM) to incorporate specific operating procedures for takeoff, instrument landing system (ILS) approaches, non-precision approaches, and go around and missed approaches, when in the presence of interference from wireless broadband operations in the 3.7–3.98 GHz frequency band (5G C-Band) interference as identified by Notices to Air Missions (NOTAMs). Since the FAA issued AD 2022–06–16, the FAA determined that additional limitations are needed due to the continued deployment of new 5G C-Band stations whose signals are expected to cover most of the contiguous United States at transmission frequencies between 3.7–3.98 GHz. This AD requires revising the limitations section of the existing AFM to incorporate limitations requiring specific operating procedures, and retains the operating procedures for takeoff, ILS approaches, non-precision approaches, and go-around and missed approaches from AD 2022–06–16, due to the presence of 5G C-Band interference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES:

This AD is effective June 21, 2023.

ADDRESSES:

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2023-0922; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Continued Operational Safety Technical Advisor, COS Program Management Section, Operational Safety Branch, FAA, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 817-222-5390; email: operationalafety@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend [14 CFR part 39](#) to supersede AD 2022-06-16, Amendment 39-21982 ([87 FR 14780](#), March 16, 2022) (AD 2022-06-16). AD 2022-06-16 applied to all The Boeing Company (Boeing) Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, and 747-400F series airplanes. The NPRM published in the **Federal Register** on May 3, 2023 ([88 FR 27734](#)). The NPRM was prompted by a determination that radio altimeters cannot be relied upon to perform their intended function if they experience 5G C-Band interference, and a determination that during takeoff, approach, landings, and go-arounds, as a result of this interference, certain airplane systems may not properly function, resulting in increased flightcrew workload while on approach with the flight director, autothrottle, or autopilot engaged.

In the NPRM, the FAA proposed to retain the AFM revisions required by AD 2022-06-16 until June 30, 2023. On or before June 30, 2023, the FAA proposed to require replacing those AFM revisions with limitations requiring the same procedures for dispatch or release to airports, and takeoff, approach, landing, and go-around on runways at all airports for non-radio altimeter tolerant airplanes. For radio altimeter tolerant airplanes, the FAA proposed that the procedures would not be required at 5G C-Band mitigated airports (5G CMAs) as identified in an FAA Domestic Notice. The FAA proposed this AD to address 5G C-Band interference that could result in increased flightcrew workload and could lead to reduced ability of the flightcrew to maintain safe flight and landing of the airplane.

Discussion of Final Airworthiness Directive

Comments

The FAA provided the public with an opportunity to comment on the proposed AD and received comments from two commenters. Boeing and the Air Line Pilots Association, International (ALPA), supported the NPRM without change. The supportive comments from ALPA included additional viewpoints without a suggestion specific to the AD or a request the FAA can act on. These comments are outside the scope of this final rule.

Conclusion

The FAA reviewed the relevant data, considered any comments received, and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. This AD is adopted as proposed in the NPRM.

Interim Action

The FAA considers this AD to be an interim action. Once the Technical Standard Order (TSO) standard for radio altimeters is established, which will follow the existing international technical consensus on the establishment of the minimum operational performance standards (MOPS), the FAA anticipates that the MOPS will be incorporated into the TSO. Once a new radio altimeter TSO is developed, approved, and available, the FAA might consider additional rulemaking.

Effective Date

Section 553(d) of the Administrative Procedure Act (APA) ([5 U.S.C. 551 et seq.](#)) requires publication of a rule not less than 30 days before its effective date. However, section 553(d) authorizes agencies to make rules effective in less than 30 days when the agency finds “good cause.” Radio altimeters cannot be relied upon to perform their intended function if they experience interference from wireless broadband operations in the 5G C-Band. This interference can cause other airplane systems to not properly function, resulting in increased flightcrew workload and could lead to reduced ability of the flightcrew to maintain safe flight and landing of the airplane. To address this unsafe condition, the actions required by this AD must be accomplished before the compliance date of June 30, 2023. The FAA based this date on the changes to the 5G C-Band environment beginning on July 1, 2023. These changes include increased wireless broadband deployment and transmissions closer to the parameters authorized by the FCC. The earlier operators learn of the requirements in this AD, the earlier they can take action to ensure compliance. An effective date less than 30 days would ensure the AD is codified earlier, thereby increasing awareness of its requirements. Therefore, the FAA finds that good cause exists pursuant to [5 U.S.C. 553\(d\)](#) for making this amendment immediately effective.

Costs of Compliance

The cost information below describes the costs to change the AFM. Although this AD largely maintains the AFM limitations currently required by AD 2022–06–16, the FAA acknowledges that this AD may also impose costs on some aircraft operators from having to change their conduct to comply with the amended AFM. However, the FAA lacks the data necessary to quantify the costs associated with aircraft operators changing their conduct.

The FAA estimates that this AD affects 137 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

Estimated Costs

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
AFM revision (retained actions from AD 2022–02–16)	1 work-hour × \$85 per hour 1 = \$85	\$0	\$85	\$11,645
New AFM revisions (new action)	1 work-hour × \$85 per hour = \$85	0	85	2 11,645

1 The labor rate of \$85 per hour is the average wage rate for an aviation mechanic.

2 The estimated cost for this revision would not constitute a significant economic impact (even for small entities) because \$85 is a minimal cost compared to the regular costs of maintaining and operating a Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, or 747–400F transport category airplane.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under [Executive Order 13132](#). This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in [14 CFR Part 39](#)

- Air transportation
- Aircraft
- Aviation safety
- Incorporation by reference
- Safety

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends [14 CFR part 39](#) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: [49 U.S.C. 106\(g\)](#), [40113](#), [44701](#).

[§ 39.13](#) [Amended]

2. The FAA amends § 39.13 by:

- a. Removing Airworthiness Directive (AD) 2022–06–16, Amendment 39–21982 ([87 FR 14780](#), March 16, 2022), and
- b. Adding the following new AD:

2023–12–14 The Boeing Company: Amendment 39–22472; Docket No. FAA–2023–0922; Project Identifier AD–2022–01431–T.

(a) Effective Date

This airworthiness directive (AD) is effective June 21, 2023.

(b) Affected ADs

This AD replaces AD 2022–06–16, Amendment 39–21982 ([87 FR 14780](#), March 16, 2022) (AD 2022–06–16).

(c) Applicability

This AD applies to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, and 747–400F series airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 34, Navigation.

(e) Unsafe Condition

This AD was prompted by a determination that radio altimeters cannot be relied upon to perform their intended function if they experience interference from wireless broadband operations in the 3.7–3.98 GHz frequency band (5G C-Band), and a determination that during takeoff, approach, landings, and go-arounds, as a result of this interference, certain airplane systems may not properly function, resulting in increased flightcrew workload while on approach with the flight director, autothrottle, or autopilot engaged. The FAA is issuing this AD to address 5G C-Band interference that could result in increased flightcrew workload and could lead to reduced ability of the flightcrew to maintain safe flight and landing of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.


(g) Definitions

(1) For purposes of this AD, a “5G C-Band mitigated airport” (5G CMA) is an airport at which the telecommunications companies have agreed to voluntarily limit their 5G deployment at the request of the FAA, as identified by an FAA Domestic Notice.

(2) For purposes of this AD, a “radio altimeter tolerant airplane” is one for which the radio altimeter, as installed, demonstrates the tolerances specified in paragraphs (g)(2)(i) and (ii) of this AD, using a method approved by the FAA.


(i) Tolerance to radio altimeter interference, for the fundamental emissions (3.7–3.98 GHz), at or above the power spectral density (PSD) curve threshold specified in figure 1 to paragraph (g)(2)(i) of this AD.

Figure 1 to paragraph (g)(2)(i)— *Fundamental Effective Isotropic PSD at Outside Interface of Aircraft Antenna*

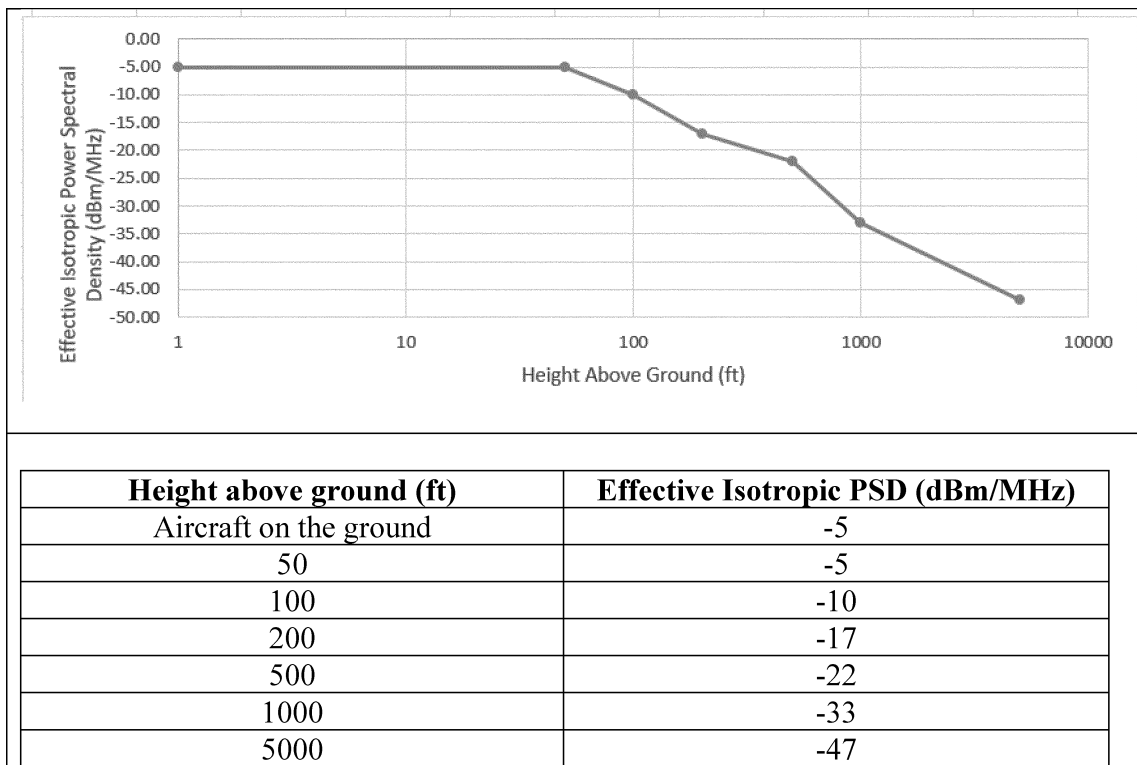

(ii) Tolerance to radio altimeter interference, for the spurious emissions (3.7–3.98 GHz), at or above the PSD curve threshold specified in figure 2 to paragraph (g)(2)(ii) of this AD.

Figure 2 to paragraph (g)(2)(ii)— *Spurious Effective Isotropic PSD at Outside Interface of Aircraft Antenna*

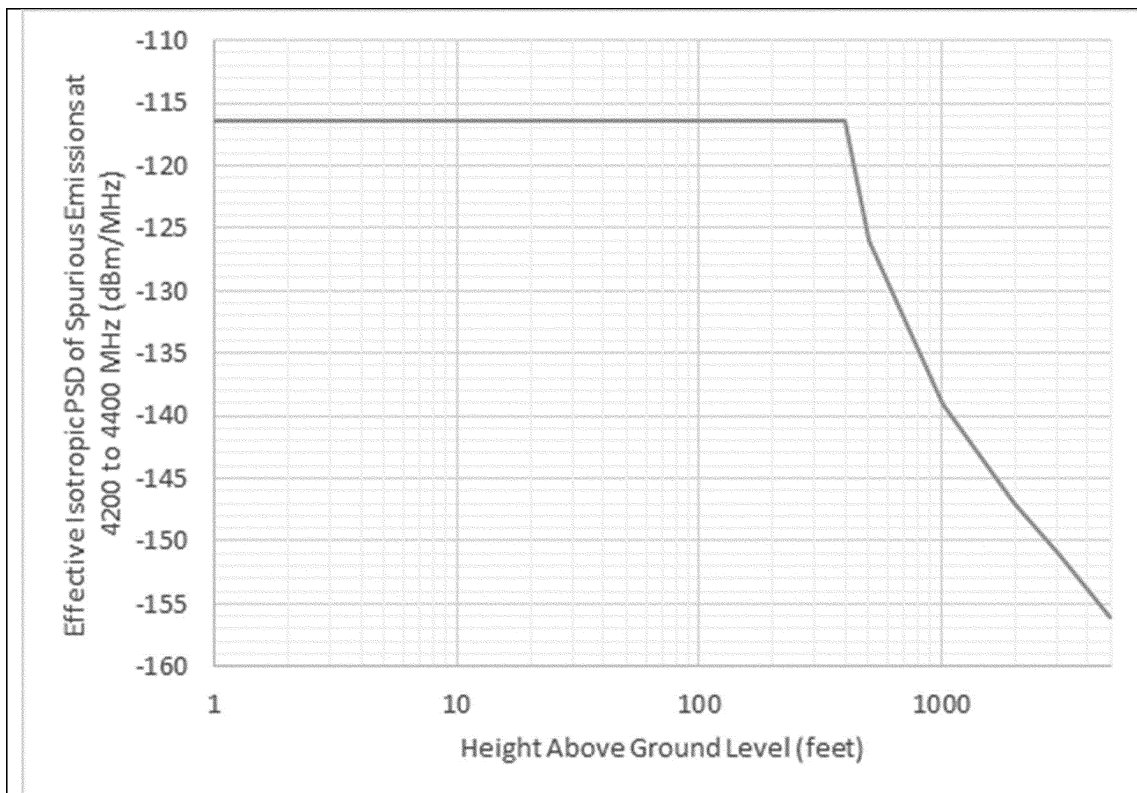

<u>Aircraft Altitude (ft AGL)</u>	<u>Effective Isotropic PSD (dBm/MHz)</u>
1	-116.50
400	-116.50
500	-126.00
1000	-139.00
2000	-147.00
3000	-151.00
5000	-156.00

(3) For purposes of this AD, a “non-radio altimeter tolerant airplane” is one for which the radio altimeter, as installed, does not demonstrate the tolerances specified in paragraphs (g)(2)(i) and (ii) of this AD.

(h) Retained Airplane Flight Manual (AFM) Revision

This paragraph restates the requirements of paragraph (h) of AD 2022–02–16.

(1) Within 2 days after March 16, 2022 (the effective date of AD 2022–06–16): Revise the Limitations Section of the existing AFM to include the information specified in figure 3 to paragraph (h)(1) of this AD. This may be done by inserting a copy of figure 3 to paragraph (h)(1) of this AD into the existing AFM.

Figure 3 to paragraph (h)(1)— *AFM Limitations Revision*

(Required by AD 2022-06-16)

Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around

The following limitations are required for dispatch or release to airports, and takeoff, approach, landing, and go-around on runways, in U.S. airspace in the presence of 5G C-Band wireless broadband interference as identified by NOTAM (NOTAMs will be issued to state the specific airports or approaches where the radio altimeter is unreliable due to the presence of 5G C-Band wireless broadband interference).

Takeoff, Approach, Landing, and Go-Around

Operators must use the Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around procedure contained in the Operating Procedures section of this AFM.

(2) Within 2 days after March 16, 2022 (the effective date of AD 2022-06-16): Revise the Operating Procedures Section of the existing AFM to include the information specified in figure 4 to paragraph (h)(2) of this AD. This may be done by inserting a copy of figure 4 to paragraph (h)(2) of this AD into the existing AFM.

Figure 4 to paragraph (h)(2)— *AFM Operating Procedures Revision*

(Required by AD 2022-06-16)

Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around

Takeoff

If autopilot does not engage above the minimum altitude, when at a safe altitude, select both flight director switches OFF, then ON, to re-engage. LNAV and VNAV may not engage or engage at an erroneous altitude after departure.

ILS Approaches

For ILS approaches, disconnect the autopilot and autothrottle, and place both flight director switches to OFF prior to glideslope intercept. Do not set RADIO minimums on the EFIS control panel, use BARO minimums only.

Non-Precision Approaches

Autopilot, autothrottles, and flight directors may be used. Do not use autothrottles if the autopilot is disengaged. Prior to descending below MDA, disconnect the autothrottle and disengage the autopilot.

Landing

Do not rely on radio altimeter-based altitude aural callouts during approach. Adjust operational (time of arrival) landing distance for manual speedbrake deployment.

During Go-Around and Missed Approach

If go-around is required, ensure thrust is increased to go-around power.

When the flight director switches are OFF, push either TO/GA switch to display the flight director bars. When able, turn both flight directors to ON.

TO/GA mode may not be available. Autopilot may not be available. Monitor pitch and roll modes for engagement.

(i) New Requirement: AFM Revision for Non-Radio Altimeter Tolerant Airplanes

For non-radio altimeter tolerant airplanes, do the actions specified in paragraphs (i)(1) and (2) of this AD.

(1) On or before June 30, 2023, revise the Limitations Section of the existing AFM to include the information specified in figure 5 to paragraph (i) of this AD. This may be done by inserting a copy of figure 5 to paragraph (i) of this AD into the existing AFM. Incorporating the AFM revision required by this paragraph terminates the AFM revision required by paragraph (h)(1) of this AD.

(2) Before further flight after incorporating the limitations specified in figure 5 to paragraph (i) of this AD, remove the AFM revision required by paragraph (h)(1) of this AD.

Figure 5 to paragraph (i)— *AFM Revision for Non-Radio Altimeter Tolerant Airplanes*

(Required by AD 2023-12-14)

Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around

Due to the presence of 5G C-Band wireless broadband interference, the following limitations are required for dispatch or release to airports, and takeoff, approach, landing, and go-around on runways, in the contiguous U.S. airspace.

Takeoff, Approach, Landing, and Go-Around

Operators must use the Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around procedure contained in the Operating Procedures section of this AFM.

(j) New Requirement: AFM Revision for Radio Altimeter Tolerant Airplanes

For radio altimeter tolerant airplanes, do the actions specified in paragraphs (j)(1) and (2) of this AD.

(1) On or before June 30, 2023, revise the Limitations Section of the existing AFM to include the information specified in figure 6 to paragraph (j) of this AD. This may be done by inserting a copy of figure 6 to paragraph (j) of this AD into the existing AFM. Incorporating the AFM revision required by this paragraph terminates the AFM revision required by paragraph (h)(1) of this AD.

(2) Before further flight after incorporating the limitations specified in figure 6 to paragraph (j) of this AD, remove the AFM revision required by paragraph (h)(1) of this AD.

Figure 6 to paragraph (j)— *AFM Revision for Radio Altimeter Tolerant Airplanes*

(Required by AD 2023-12-14)

Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around

Due to the presence of 5G C-Band wireless broadband interference, the following limitations are required for dispatch or release to airports, and takeoff, approach, landing, and go-around on runways, in the contiguous U.S. airspace unless operating at a 5G C-Band mitigated airport as identified in an FAA *Domestic Notice*.

Takeoff, Approach, Landing, and Go-Around

Operators must use the Radio Altimeter 5G C-Band Interference, Takeoff, Approach, Landing, and Go-Around procedure contained in the Operating Procedures section of this AFM.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in [14 CFR 39.19](#). In accordance with [14 CFR 39.19](#), send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the Operational Safety Branch, send it to the

attention of the person identified in paragraph (l) of this AD. Information may be emailed to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) AMOCs approved for AD 2021–23–12, Amendment 39–21810 ([86 FR 69984](#), December 9, 2021), providing relief for specific radio altimeter installations are approved as AMOCs for the requirements specified in paragraph (h) of this AD until June 30, 2023.

(l) Related Information

For more information about this AD, contact Brett Portwood, Continued Operational Safety Technical Advisor, COS Program Management Section, Operational Safety Branch, FAA, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 817–222–5390; email: operationalsafety@faa.gov.

(m) Material Incorporated by Reference

None.

Issued on June 9, 2023.

Michael Linegang,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

BILLING CODE 4910–13–P

[FR Doc. 2023–13149 Filed 6–16–23; 11:15 am]

BILLING CODE 4910–13–C