



適航指令發布單

Airworthiness Directive Issuance Form

民航局AD編號 AD number	CAA-2025-04-017	發布日期 Date issued	2025/04/28
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.		
主旨摘要 Subject	Landing Gear - Nose Landing Gear Shock Absorber - Functional Check		
民航局 CAA <input type="radio"/> 本國產品 Native product <input type="radio"/> 其他個案 Other	設計國民航主管機構 Original Authority <input type="radio"/> FAA <input type="radio"/> Germany LBA <input checked="" type="radio"/> EASA <input type="radio"/> CAA-NL <input type="radio"/> Brazil <input type="radio"/> UK CAA <input type="radio"/> Transport Canada Civil Aviation <input type="radio"/> Japan CAB <input type="radio"/> DGAC <input type="radio"/> CAA of Israel <input type="radio"/> Other_____		
	設計國AD編號 Original AD number	2025-0093	
	1. 直接採用原AD之內容? (Is the original AD directly adopted?) <input checked="" type="radio"/> 是(Yes) <input type="radio"/> 否(No)_ a. 生效日期另訂為(Re-specify the effective date as): b. 執行時限另訂為(Re-specify the compliance time or period as): 2. 使用人是否需要將AD執行結果向民航局提出報告? (Do users need to report the status of compliance to the CAA?) <input type="radio"/> 需要(Yes) <input checked="" type="radio"/> 不需要(No)		
備註 Note	This AD supersedes EASA AD 2024-0188(CAA-2024-09-014) dated 27 September 2024.		

註： 1. AD內容後附。

2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。

3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.

2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.

3. For further information, please contact Civil Aviation Administration on Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464, adcaa@mail.caa.gov.tw



Airworthiness Directive

AD No.: 2025-0093

Issued: 24 April 2025

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS S.A.S.

Type/Model designation(s):

A350 aeroplanes

Effective Date: 08 May 2025

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Supersedure: This AD supersedes EASA AD 2024-0188 dated 27 September 2024.

ATA 32 – Landing Gear – Nose Landing Gear Shock Absorber – Functional Check

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 and A350-1041 aeroplanes, all manufacturer serial numbers.

Definitions:

For the purpose of this AD, the following definitions apply:

Affected part: Nose Landing Gear (NLG) Sliding Piston Assembly having Part Number (P/N) 6407A2000-01, P/N 6407A2000-02, P/N 6407A2000-03 (Common NLG standard), P/N 5035A3200-01 or P/N 5035A3200-02 (EIS NLG Standard).

Not affected part: NLG Sliding Piston Assembly P/N 6407A2000-04, or later approved Airbus P/N.

The AOT: Airbus Alert Operators Transmission (AOT) A32P031-24 Revision 04.

Aeroplane date of manufacture: The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator, which is referenced in Airbus documentation.



Groups:

Group 1 aeroplanes are those equipped with a NLG Sliding Piston Assembly P/N 6407A2000-01, P/N 6407A2000-02 or P/N 6407A2000-03, fitted on a NLG P/N 6406Axxxx (common standard).

Group 2 aeroplanes are those equipped with a NLG Sliding Piston Assembly P/N 5035A3200-01 or P/N 5035A3200-02 (EIS NLG Standard) fitted on a NLG P/N 4816Axxxx (EIS Standard).

Group 3 aeroplanes are those equipped with a NLG Sliding Piston Assembly P/N 6407A2000-01, P/N 6407A2000-02 or P/N 6407A2000-03, fitted on a NLG P/N 6406Bxxxx.

Group 4 aeroplanes are those that do not have an affected part installed.

Note 1: 'xxxx' represents any numerical sequence value.

Reason:

Mechanical noises, originating from the NLG shock absorber during ground manoeuvres, were reported. These noises have been attributed to an increased friction between the lower bearing carrier (LBC) and the main fitting of the sliding tube. This increased friction may result in deformation of the anti-rotation tabs located on the LBC and consequently, relative movement may occur between the LBC and the main fitting. That might cause wear of the corrosion protection coating on the main fitting due to subsequent movement of the retainer ring positioned between the two components, which could gradually lead to corrosion of the NLG main fitting itself.

This condition, if not detected and corrected, could lead to structural failure of the NLG and consequent collapse, possibly resulting in damage to the aeroplane and injury to occupants.

To address this potential unsafe condition, Airbus issued the AOT Revision 03 to provide inspection instructions. Consequently, EASA issued AD 2024-0188 to require a steering check of the affected parts and depending on findings, accomplishment of applicable corrective action(s).

Since that AD was issued, it has been determined that one additional NLG P/N is affected. The AOT A32P031-24 at Revision 04 has been published to update applicability to NLG Sliding Piston Assembly fitted on a NLG having P/N 6406Bxxxx.

For the reasons described above, this AD retains the requirements of the EASA AD 2024-0188, which is superseded, and introduces specific requirements for Group 3 aeroplanes.

This AD is considered to be an interim action and further AD action may follow.

Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the action(s) required by this AD have been already accomplished:

Repetitive Functional Check(s):

- (1) For Group 1, Group 2 and Group 3 aeroplanes: Before exceeding the threshold and, thereafter, at intervals not to exceed the values as specified in Table 1 of this AD, as applicable, accomplish a steering check of the affected part, in accordance with the instructions of the AOT (see Note 2



of this AD).

Table 1 - Threshold and Interval for Steering Check

Group	Initial Steering Check Threshold (whichever occurs later)	Repetitive Steering Check Interval
1	Before exceeding 250 flight cycles (FC) since aeroplane date of manufacture, or within 2 months after 04 October 2024 [the effective date of EASA AD 2024-0188]	250 FC
2	Before exceeding 1 000 FC since aeroplane date of manufacture, or within 17 months after 04 October 2024 [the effective date of EASA AD 2024-0188]	1 000 FC
3	Within 50 FC from the effective date of this AD or 250 FC from the date of first installation of the affected part on that aeroplane	250 FC

Note 2: The scope of repetitive inspections is limited to the section 5.6, points f. and following of the procedure of the AOT.

- (2) If, during any steering check as required by paragraph (1) of this AD, any discrepancies as identified in the AOT are detected, before next flight, accomplish the applicable corrective action(s) in accordance with the instructions of the AOT, or contact Airbus to obtain approved instructions and, within the compliance time(s) specified therein, accomplish those instructions accordingly.

Parts Installation:

- (3) For Group 1, Group 2 and Group 3 aeroplanes: From the effective date of this AD, it is allowed to install on an aeroplane a NLG with an affected part, provided that, following installation and before next flight, the affected part installed on this NLG is checked in accordance with the steering check instructions of the AOT referred to in paragraph (1), and, depending on findings, corrected as applicable in accordance with the instructions of the AOT and, thereafter, repetitively checked as required by this AD.
- (4) For Group 4 aeroplanes: From the effective date of this AD, do not install an affected part on any aeroplane, or a NLG having an affected part installed.

Reporting:

- (5) If, during any steering check as required by paragraph (1) of this AD, any discrepancies as identified in the AOT are detected, within 30 days after that steering check, report the inspection results to Airbus. Using the Reporting Form attached to the AOT is an acceptable method to comply with this requirement.

Terminating Action:

- (6) None.



Credit:

- (7) Steering checks and corrective action(s) accomplished on an aeroplane before the effective date of this AD in accordance with the instructions of AOT A32P031-24 at original issue, Revision 1, Revision 2 or Revision 03 are acceptable to comply with the initial requirements of the paragraphs (1) and (2) of this AD, as applicable, for that aeroplane.

Ref. Publications:

Airbus AOT A32P031-24 original issue dated 18 April 2024, Revision 01 dated 29 July 2024, Revision 2 dated 28 August 2024, Revision 03 dated 26 September 2024, or Revision 04 dated 11 March 2025.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. Based on the required actions and the compliance time, EASA have decided to issue a Final AD with Request for Comments, postponing the public consultation process until after publication. All interested persons may send their comments, referencing the AD Number, to the E-mail address specified in below Remark 3, prior to 22 May 2025. Only if any comment is received during the consultation period, a Comment Response Document will be published in the [EASA Safety Publications Tool](#), in a compressed ('zipped') file, attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS A350 XWB (1IAK), E-mail: continued-airworthiness.a350@airbus.com.

