



適航指令發布單

Airworthiness Directive Issuance Form

民航局AD編號 AD number	CAA-2025-05-010	發布日期 Date issued	2025/05/21
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	ATR 42-500 and ATR 72-212A aeroplanes having a manufacturer serial number (MSN) as listed in the SB1 or the SB2, as defined in this AD.		
主旨摘要 Subject	Stabilizers - Horizontal Stabilizer Front Box, Centre Box and Front Spar Web - Inspection		
民航局 CAA <input type="radio"/> 本國產品 Native product <input type="radio"/> 其他個案 Other	設計國民航主管機構 Original Authority <input type="radio"/> FAA <input type="radio"/> Germany LBA <input checked="" type="radio"/> EASA <input type="radio"/> CAA-NL <input type="radio"/> Brazil <input type="radio"/> UK CAA <input type="radio"/> Transport Canada Civil Aviation <input type="radio"/> Japan CAB <input type="radio"/> DGAC <input type="radio"/> CAA of Israel <input type="radio"/> Other_____		
	設計國AD編號 Original AD number	2025-0110	
	1. 直接採用原AD之內容? (Is the original AD directly adopted?) <input checked="" type="radio"/> 是(Yes) <input type="radio"/> 否(No)_ a. 生效日期另訂為(Re-specify the effective date as): b. 執行時限另訂為(Re-specify the compliance time or period as): 2. 使用人是否需要將AD執行結果向民航局提出報告? (Do users need to report the status of compliance to the CAA?) <input type="radio"/> 需要(Yes) <input checked="" type="radio"/> 不需要(No)		
備註 Note	This AD supersedes EASA AD 2023-0125(CAA-2023-06-005) dated 22 June 2023.		

註： 1. AD內容後附。

2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。

3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464,

adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.

2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.

3. For further information, please contact Civil Aviation Administration on Tel：(02)2349-6330 / 6332,

Fax：(02)2545-8464, adcaa@mail.caa.gov.tw



Airworthiness Directive

AD No.: 2025-0110

Issued: 14 May 2025

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

ATR-GIE AVIONS de TRANSPORT RÉGIONAL

Type/Model designation(s):

ATR 42 and ATR 72 aeroplanes

Effective Date: 28 May 2025

TCDS Number(s): EASA.A.084

Foreign AD: Not applicable

Supersedure: This AD supersedes EASA AD 2023-0125 dated 22 June 2023.

ATA 55 – Stabilizers – Horizontal Stabilizer Front Box, Centre Box and Front Spar Web – Inspection

Manufacturer(s):

ATR-GIE Avions de Transport Régional, formerly EADS ATR - Alenia, Aerospatiale Matra ATR - ALENIA, Aerospatiale - Alenia, Aerospatiale - Aeritalia

Applicability:

ATR 42-500 and ATR 72-212A aeroplanes having a manufacturer serial number (MSN) as listed in the SB1 or the SB2, as defined in this AD.

Definitions:

For the purpose of this AD, the following definitions apply:

The SB1: ATR Service Bulletin (SB) ATR42-55-0020 Revision 03 or SB ATR72-55-1013 Revision 03, as applicable.

The SB2: ATR SB ATR42-55-0025 or SB ATR72-55-1018, as applicable.

Groups: Group 1 aeroplanes are those having an MSN as listed in the SB1, and which are not Group 2.

Group 2 aeroplanes are ATR42-500 aeroplanes having MSN 530, 534, 537, 539, 542, 544, 549, 551, 554, 556, 559, 561, 564, 566, 569, 571, 574, 576, 579, 581, 584, 586, 589, 591, 594, 596, 599, 602,



603, 604, 605, 606, 607, 608, 609, 610, 611, 614, 615, 616, 617, 618, 619, 620, 621, 622, 623, 625, 627, 631, 633, 637, 639, 641, 645, 647, 649, 651, 653, 655, 659, 661, 667, 669, 1604, 1613, 1615 or 1616, and

ATR72-212A aeroplanes having MSN 560, 567, 568, 570, 573, 575, 577, 578, 585, 588, 592, 595, 597, 600, 628, 630, 632, 634, 636, 644, 646, 648, 650, 652, 654, 658, 662, 666, 672, 674, 676, 677, 678, 679, 680, 681, 682, 683, 684, 685, 686, 687, 688, 690, 692, 694, 696, 697, 698, 699, 700, 701, 702, 703, 704, 705, 706, 707, 708, 709, 710, 711, 712, 713, 714, 715, 716, 717, 718, 719, 720, 722, 723, 724, 726, 727, 728, 730, 731, 734, 735, 736, 740, 741, 742, 744, 745, 746, 747, 748, 749, 751, 752, 753, 755, 756, 757, 758, 759, 760, 761, 762, 763, 764, 769, 1629, 1637, 1649, 1673, 1696, 1735, 1741 or 1753.

Group 3 aeroplanes are those having an MSN as listed in the SB2.

Depending on the MSN, certain aeroplanes can be both a Group 1 and a Group 3 aeroplane, or a Group 2 and a Group 3 aeroplane.

Affected area(s) 1: Horizontal stabilizer (HS) left-hand and right-hand leading edge lateral ribs, the box in between and the centre box upper panel; and HS forward back-up fitting.

Affected area(s) 2: HS front spar web and centre box internal area.

Reason:

Several occurrences were reported, where loose fasteners and cracks were found in the affected area(s) 1 on some in-service aeroplanes. Subsequent investigations identified possible manufacturing deviations, resulting in a list of Horizontal Tail Planes (HTP) which might be affected by similar issues.

This condition, if not detected and corrected, could reduce the structural integrity of the aeroplane.

To address this potential unsafe condition, ATR issued SB ATR42-55-0020 and SB ATR72-55-1013, both later revised, to provide inspection instructions. Consequently, EASA issued AD 2023-0125 to require a one-time detailed inspection (DET) of the affected area(s) 1, as defined in this AD, and, depending on findings, accomplishment of applicable corrective action(s).

Since that AD was issued, it has been determined that additional aeroplanes are affected, and that also the affected area(s) 2, as defined in this AD, have to be inspected.

Consequently, ATR issued the SB1, extending its effectivity, and the SB2, to provide additional inspection instructions.

For the reasons described above, this AD retains the requirements of EASA AD 2023-0125, which is superseded, expands the applicability and requires inspection of additional areas.

Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the action(s) required by this AD have been already accomplished:



Inspection(s):

- (1) Within the compliance time specified in Table 1 of this AD, as applicable, accomplish a one-time DET of the affected area(s) 1 and the affected area(s) 2, in accordance with the instructions of the SB1 or the SB2, as applicable.

Table 1 – Compliance Time and Applicable SB

Group	Compliance Time	SB
1	Within 24 months after 06 July 2023 [the effective date of EASA AD 2023-0125]	SB1
2	Within 24 months after the effective date of this AD	SB1
3	Within 24 months after the effective date of this AD	SB2

Corrective Action(s):

- (2) If, during the DET as required by paragraph (1) of this AD, any discrepancy as defined in the SB1 or the SB2, as applicable, is detected, before next flight, contact ATR for approved repair instructions and, within the compliance time specified therein, accomplish those instructions accordingly. If no compliance time for the repair is identified in those instructions, accomplish those instructions before next flight.

Credit:

- (3) Inspection of the affected area(s) 1 accomplished on an aeroplane before the effective date of this AD, in accordance with the instructions of SB ATR42-55-0020 at original issue, Revision 01 or Revision 02, or of SB ATR72-55-1013 at original issue, Revision 01 or Revision 02, as applicable, is acceptable to comply with the affected area(s) 1 inspection requirement of paragraph (1) of this AD, as defined in SB1, for that aeroplane.

Ref. Publications:

ATR SB ATR42-55-0020 original issue dated 02 March 2023, or Revision 01 dated 24 July 2023, or Revision 02 dated 03 September 2024, or Revision 03 dated 31 January 2025.

ATR SB ATR72-55-1013 original issue dated 02 March 2023, or Revision 01 dated 24 July 2023, or Revision 02 dated 03 September 2024, or Revision 03 dated 31 January 2025.

ATR SB ATR42-55-0025 original issue dated 03 February 2025.

ATR SB ATR72-55-1018 original issue dated 03 February 2025.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.



2. This AD was posted on 12 March 2025 as PAD 25-047 for consultation until 09 April 2025 and republished on 13 March 2025 as PAD 25-047R1 for additional consultation until 10 April 2025. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: ATR - GIE Avions de Transport Régional, Continued Airworthiness Service, Telephone: +33 (0)5 62 21 62 21, Fax: +33 (0) 5 62 21 67 18; E-mail: continued.airworthiness@atr-aircraft.com.

