



適航指令發布單

Airworthiness Directive Issuance Form

民航局AD編號 AD number	CAA-2025-06-007	發布日期 Date issued	2025/06/27												
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Diamond Aircraft Industries Inc (DAI) Models DA40 NG, DA40, DA40 F and DA40 D, All Serial Numbers														
主旨摘要 Subject	Doors - Passenger Door Separation														
民航局 CAA <input type="radio"/> 本國產品 Native product <input type="radio"/> 其他個案 Other	設計國民航主管機構 Original Authority <table><tr><td><input type="radio"/> FAA</td><td><input type="radio"/> Germany LBA</td></tr><tr><td><input type="radio"/> EASA</td><td><input type="radio"/> CAA-NL</td></tr><tr><td><input type="radio"/> Brazil</td><td><input type="radio"/> UK CAA</td></tr><tr><td><input checked="" type="radio"/> Transport Canada Civil Aviation</td><td><input type="radio"/> Japan CAB</td></tr><tr><td><input type="radio"/> DGAC</td><td><input type="radio"/> CAA of Israel</td></tr><tr><td></td><td><input type="radio"/> Other_____</td></tr></table>			<input type="radio"/> FAA	<input type="radio"/> Germany LBA	<input type="radio"/> EASA	<input type="radio"/> CAA-NL	<input type="radio"/> Brazil	<input type="radio"/> UK CAA	<input checked="" type="radio"/> Transport Canada Civil Aviation	<input type="radio"/> Japan CAB	<input type="radio"/> DGAC	<input type="radio"/> CAA of Israel		<input type="radio"/> Other_____
<input type="radio"/> FAA	<input type="radio"/> Germany LBA														
<input type="radio"/> EASA	<input type="radio"/> CAA-NL														
<input type="radio"/> Brazil	<input type="radio"/> UK CAA														
<input checked="" type="radio"/> Transport Canada Civil Aviation	<input type="radio"/> Japan CAB														
<input type="radio"/> DGAC	<input type="radio"/> CAA of Israel														
	<input type="radio"/> Other_____														
	設計國AD編號 Original AD number	CF-2025-30													
	1. 直接採用原AD之內容? (Is the original AD directly adopted?) <input checked="" type="radio"/> 是(Yes) <input type="radio"/> 否(No)_ a. 生效日期另訂為(Re-specify the effective date as): b. 執行時限另訂為(Re-specify the compliance time or period as): 2. 使用人是否需要將AD執行結果向民航局提出報告? (Do users need to report the status of compliance to the CAA?) <input type="radio"/> 需要(Yes) <input checked="" type="radio"/> 不需要(No)														
備註 Note	ATA 52. SB: DAI Mandatory SB MSB 40-103/ MSB F4-042/ MSB D4-114/ MSB 40NG-084 (published as a single document) Revision 2 dated 5 June 2025, which refers to WI-MSB 40-103/ WI-MSB F4-042/ WI-MSB D4-114/ WI-MSB 40NG-084.														

註： 1. AD內容後附。

2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。

3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464,

adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.

2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.

3. For further information, please contact Civil Aviation Administration on Tel：(02)2349-6330 / 6332,

Fax：(02)2545-8464, adcaa@mail.caa.gov.tw



AIRWORTHINESS DIRECTIVE

This Airworthiness Directive (AD) is issued pursuant to Canadian Aviation Regulation (CAR) 521.427. No person shall conduct a take-off or permit a take-off to be conducted in an aircraft that is in their legal custody and control, unless the requirements of CAR 605.84 pertaining to ADs are met. Standard 625 - Aircraft Equipment and Maintenance Standards Appendix H provides information concerning alternative means of compliance (AMOC) with ADs.

Number:

CF-2025-30

Effective Date:

7 July 2025

ATA:

52

Type Certificate:

A-224

Subject:

Doors – Passenger Door Separation

Applicability:

Diamond Aircraft Industries Inc (DAI) Models DA40 NG, DA40, DA40 F and DA40 D, All Serial Numbers

Compliance:

As indicated below, unless already accomplished.

Background:

Several occurrences of passenger door separation have been reported to DAI. Although, in some cases, the root cause could be attributed to improper latching of the passenger door and subsequent attempts to latch the passenger door in flight, the root cause of the remaining occurrences could not yet be identified.

Passenger door separation could result in damage to the aircraft structure, possibly leading to loss of control of the aircraft, and/or injuries to persons on the ground.

To address this unsafe condition, DAI has issued:

- an Aircraft Flight Manual Temporary Revision (AFM-TR) introducing amended procedures and limitations, and
- a Service Bulletin (SB) providing instructions to install placards in the cabin to prevent misuse of the passenger door, and to inspect the passenger door latching mechanism and safety hook mechanisms in support of the continuing investigation into the root cause of the door separation.

The corrective actions in this AD are an interim action and further AD action may follow.

Corrective Actions:

For the purposes of this AD, the following definitions apply:

The SB: DAI Mandatory SB MSB 40-103/ MSB F4-042/ MSB D4-114/ MSB 40NG-084 (published as a single document) Revision 2 dated 5 June 2025, which refers to WI-MSB 40-103/ WI-MSB F4-042/ WI-MSB D4-114/ WI-MSB 40NG-084.

The WI: Work Instruction (WI) WI-MSB 40-103/ WI-MSB F4-042/ WI-MSB D4-114/ WI-MSB 40NG-084 (published as a single document) revision 2, or later revisions approved by Chief, Continuing Airworthiness, Transport Canada.

The AFM TR:

For DAI aircraft models DA 40 and DA 40F

Aircraft Flight Manual (AFM) Temporary Revision (TR) MÄM-40-1203.

For DAI aircraft models DA 40 D and DA 40 NG

Aircraft Flight Manual (AFM) Temporary Revision (TR) MÄM-40-1203a

Flight Manual Amendment

1. Within 100 hours air time or 100 days, whichever occurs first, after the effective date of this AD, incorporate the AFM TR, or later Transport Canada (TC) approved AFM revision which includes the AFM TR as required by this AD, into the applicable AFM for all affected aircraft.

Note: The AFM amendment as required by paragraph 1 of this AD can be accomplished before the inspection and modification as required by paragraph 2 and 3 of this AD.

Inspection and Modification**For DAI aircraft models DA 40, DA 40 D, DA 40 F, DA 40 NG with less than 100 total hours air time on the effective date of this AD,**

2. Within 100 hours air time or 100 days, whichever occurs first, after the effective date of this AD, accomplish the inspections and modification of the aircraft in accordance with the accomplishment instructions of section III of the WI, except for paragraphs 2-4, 6-18, 25, 27, 29 and 32.

Note: Accomplishment of corrective action 2 above using DAI Mandatory SB MSB 40-103/ MSB F4-042/ MSB D4-114/ MSB 40NG-084 (published as a single document) Revision 0 dated 20 March 2025 or Revision 1 dated 16 May 2025, which refers to WI-MSB 40-103/ WI-MSB F4-042/ WI-MSB D4-114/ WI-MSB 40NG-084, satisfies the intent of this AD.

For DAI aircraft models DA 40, DA 40 D, DA 40 F, DA 40 NG with 100 total hours or more air time on the effective date of this AD,

3. Within 100 hours air time or 100 days, whichever occurs first, after the effective date of this AD, accomplish the inspections and modification of the aircraft in accordance with the accomplishment instructions of section III of the WI.

Note: Accomplishment of corrective action 3 above using DAI Mandatory SB MSB 40-103/ MSB F4-042/ MSB D4-114/ MSB 40NG-084 (published as a single document) Revision 0 dated 20 March 2025 or Revision 1 dated 16 May 2025, which refers to WI-MSB 40-103/ WI-MSB F4-042/ WI-MSB D4-114/ WI-MSB 40NG-084, satisfies the intent of this AD.

4. If, during accomplishment of inspection paragraph 20 (f) of section III of the WI, the force is less than 1.8kg (18N) and,

WI Section III Inspection step 20 (c) passed	<ol style="list-style-type: none"> i. Repeat inspection paragraph 20 (c) every 100 air time hours in accordance with the accomplishment instructions of the WI until replacement of the gas spring per 4 (ii) below, ii. Within 12 months from the effective date of this AD, replace the gas spring in accordance with the accomplishment instructions of the WI
WI Section III Inspection step 20 (c) failed	<ol style="list-style-type: none"> iii. Before further flight, replace the gas spring in accordance with the accomplishment instructions of the WI.

5. If, during any inspection performed in accordance with paragraph 2 or 3 of this AD, any discrepancy, as defined in the SB, is identified, contact DAI for instructions and accomplish the applicable corrective action(s) in accordance with the approved instructions before further flight.

Authorization:

For the Minister of Transport,

ORIGINAL SIGNED BY

Jenny Young
Chief, Continuing Airworthiness
Issued on 23 June 2025

Contact:

Grant Walker, Continuing Airworthiness, Ottawa, telephone 888-663-3639 or e-mail
TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca or any Transport Canada Centre.