



適航指令發布單

Airworthiness Directive Issuance Form

民航局AD編號 AD number	CAA-2026-03-013A	發布日期 Date issued	2026/06/12
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	Airbus A330-243, A330-243F, A330-341, A330-342, A330-343, A330-743L, A330-841 and A330-941 aeroplanes, all manufacturer serial numbers (MSN); and Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.		
主旨摘要 Subject	Fuel Low Pressure Shut-Off Valve - Leak Check		
民航局 CAA <input type="radio"/> 本國產品 Native product <input type="radio"/> 其他個案 Other	設計國民航主管機構 Original Authority <input type="radio"/> FAA <input type="radio"/> Germany LBA <input checked="" type="radio"/> EASA <input type="radio"/> CAA-NL <input type="radio"/> Brazil <input type="radio"/> UK CAA <input type="radio"/> Transport Canada Civil Aviation <input type="radio"/> Japan CAB <input type="radio"/> DGAC <input type="radio"/> CAA of Israel <input type="radio"/> Other_____		
	設計國AD編號 Original AD number	2026-0060R1	
	1. 直接採用原AD之內容? (Is the original AD directly adopted?) <input checked="" type="radio"/> 是(Yes) <input type="radio"/> 否(No)_ a. 生效日期另訂為(Re-specify the effective date as): b. 執行時限另訂為(Re-specify the compliance time or period as): 2. 使用人是否需要將AD執行結果向民航局提出報告? (Do users need to report the status of compliance to the CAA?) <input type="radio"/> 需要(Yes) <input checked="" type="radio"/> 不需要(No)		
備註 Note	This AD revises EASA AD 2026-0060(CAA-2026-03-013) dated 20 March 2026.		

註： 1. AD內容後附。
2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。
3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464,
adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.
2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.
3. For further information, please contact Civil Aviation Administration on Tel：(02)2349-6330 / 6332,
Fax：(02)2545-8464, adcaa@mail.caa.gov.tw



Airworthiness Directive

AD No.: 2026-0060R1

Issued: 09 June 2026

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS S.A.S.

Type/Model designation(s):

A330 and A340 aeroplanes

Effective Date: Revision 1: 16 June 2026
Original issue: 03 April 2026

TCDS Number(s): EASA.A.004 and EASA.A.015

Foreign AD: Not applicable

Revision: This AD revises EASA AD 2026-0060 dated 20 March 2026.

ATA 28 – Fuel – Fuel Low Pressure Shut-Off Valve – Leak Check

Manufacturer(s):

Airbus, formerly Airbus Industrie

Applicability:

Airbus A330-243, A330-243F, A330-341, A330-342, A330-343, A330-743L, A330-841 and A330-941 aeroplanes, all manufacturer serial numbers (MSN); and

Airbus A340-211, A340-212, A340-213, A340-311, A340-312, A340-313, A340-541, A340-542, A340-642 and A340-643 aeroplanes, all MSN.

Definitions:

For the purpose of this AD, the following definitions apply:

The SB: Airbus Service Bulletin (SB) A330-28-3145, SB A340-28-4146 or SB A340-28-5064, as applicable.

Affected part: Fuel low pressure shut-off valve (LPSOV) Part Number (P/N) HTE900212, P/N 12M0134-1100, P/N FRH120199M, P/N 12M0090, P/N FRH120266M and P/N FRH120197M.

Serviceable part: Any fuel LPSOV eligible for installation in accordance with Airbus instructions.



Groups:

Group 1 aeroplanes are those that have an affected part installed.

Group 2 aeroplanes are those that do not have an affected part installed.

Aeroplane reference date: The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator, which is referenced in Airbus documentation.

Reason:

Occurrences of leaks on closed fuel LPSOV were reported. Depending on its amount, a fuel leak from LPSOV could sustain a fire.

This condition, if not detected and corrected, could lead to the inability to extinguish a fire, and result in significant damage of aeroplane structure or systems.

To address this potential unsafe condition, Airbus published the SB, providing instructions for repetitive leak checks of the affected parts, and EASA issued AD 2026-0060 to require repetitive leak checks of the affected parts and, depending on findings, accomplishment of corrective actions.

Since that AD was issued, comments have been received from operators. This AD is revised to provide clarifications, and to correct the definition of “Group 2 aeroplanes”.

Required Action(s) and Compliance Time(s):

Required as indicated, by this AD, unless the action(s) required by this AD have been already accomplished:

Repetitive Leak Checks:

- (1) For Group 1 aeroplanes: Within the initial compliance time as defined in Table 1 of this AD, as applicable, and, thereafter, at intervals not to exceed 13 000 flight hours (FH), or 6 500 flight cycles (FC) or 144 months, whichever occurs first, accomplish a leak check of each affected part in accordance with the instructions of the SB.

Table 1 – Initial Compliance Time

Aeroplane Reference Date	Compliance Time
Before 03 April 2026 [the effective date of the original issue of this AD]	Between 12 November 2025 and 03 March 2029 [35 months after the effective date of the original issue of this this AD]
On or after 03 April 2026 [the effective date of the original issue of this AD]	Within 13 000 FH, or 6 500 FC or 144 months, whichever occurs first after the aeroplane reference date

Corrective Actions:

- (2) If, during any leak check as required by paragraph (1) of this AD, any discrepancy of an affected part, as specified in the SB, is detected, before next flight, replace that affected part with a serviceable part. This replacement can be accomplished in accordance with the instructions of the SB.



Terminating Action:

(3) None.

Part(s) Installation:

(4) For Group 1 and Group 2 aeroplanes: From 03 April 2026 [the effective date of the original issue of this AD], it is allowed to install an affected part on an aeroplane provided that, before next flight after installation, it passes a leak check in accordance with the instructions of the SB (see Note 1 of this AD).

Note 1: Following installation of an affected part on an aeroplane, that aeroplane is a Group 1 aeroplane, and the actions required by this AD for Group 1 aeroplanes, as applicable, must be accomplished accordingly.

Acceptable Method of Compliance:

- (5) Accomplishment on an affected part of an aeroplane of Airbus MPD task 282400-03-1, 282400-03-2 or 282400-03-3 constitutes an acceptable method to accomplish the actions as required by paragraphs (1), (2) and (4) of this AD, as applicable, for that affected part of that aeroplane.
- (6) Accomplishment on an affected part of an aeroplane of Airbus AMM task 28-24-00-710-807-A 'Operational Check to Confirm LP Valve Isolates Fuel Supply to Associated Engine' constitutes an acceptable method to accomplish a leak check as required by paragraph (1) or (4) of this AD, as applicable, for that affected part of that aeroplane.

Credit:

(7) Accomplishment of a leak check on an aeroplane, in accordance with the instructions of the SB, meets the requirement to perform MPD task 282400-03-3 (CMR for A340-200/300 aeroplanes) or MPD task 282400-03-1 (CMR) for A340-500/600 aeroplanes), as applicable.

Ref. Publications:

Airbus SB A330-28-3145 original issue dated 13 November 2025.

Airbus SB A340-28-4146 original issue dated 13 November 2025.

Airbus SB A340-28-5064 original issue dated 13 November 2025.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

- If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
- The original issue of this AD was posted on 16 December 2025 as PAD 25-194 for consultation until 13 January 2026. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.



3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – 1IAL (Airworthiness Office), E-mail: airworthiness.A330-A340@airbus.com.

