



適航指令發布單

Airworthiness Directive Issuance Form

民航局AD編號 AD number	CAA-2026-08-004修訂	發布日期 Date issued	2026/09/21												
適用之航空產品 Applied to (models, serial numbers or part numbers, as applicable)	This AD applies to International Aero Engines AG (IAE AG) Model V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5 engines with a3rd stage high-pressure compressor (HPC) rotor blade having part number (P/N) 6A8353 or P/N6A8688 installed.														
主旨摘要 Subject	[Correction] Turbine Engine - 3rd-Stage High Pressure Compressor - Replacement														
民航局 CAA ☐ 本國產品 Native product ☐ 其他個案 Other	設計國民航主管機構 Original Authority <table><tr><td>☒ FAA</td><td>☐ Germany LBA</td></tr><tr><td>☐ EASA</td><td>☐ CAA-NL</td></tr><tr><td>☐ Brazil</td><td>☐ UK CAA</td></tr><tr><td>☐ Transport Canada Civil Aviation</td><td>☐ Japan CAB</td></tr><tr><td>☐ DGAC</td><td>☐ CAA of Israel</td></tr><tr><td></td><td>☐ Other_____</td></tr></table>			☒ FAA	☐ Germany LBA	☐ EASA	☐ CAA-NL	☐ Brazil	☐ UK CAA	☐ Transport Canada Civil Aviation	☐ Japan CAB	☐ DGAC	☐ CAA of Israel		☐ Other_____
☒ FAA	☐ Germany LBA														
☐ EASA	☐ CAA-NL														
☐ Brazil	☐ UK CAA														
☐ Transport Canada Civil Aviation	☐ Japan CAB														
☐ DGAC	☐ CAA of Israel														
	☐ Other_____														
	設計國AD編號 Original AD number	2026-17-03Correction													
	1. 直接採用原AD之內容? (Is the original AD directly adopted?) ☒ 是(Yes) ☐ 否(No)_ a. 生效日期另訂為(Re-specify the effective date as): b. 執行時限另訂為(Re-specify the compliance time or period as): 2. 使用人是否需要將AD執行結果向民航局提出報告? (Do users need to report the status of compliance to the CAA?) ☐ 需要(Yes) ☒ 不需要(No)														
備註 Note	This AD correct FAA AD 2026-17-03(CAA-2026-08-004).														

註： 1. AD內容後附。
2. 航空器產品使用人得向民航局提出豁免、替代符合方法、執行時限之展延之申請。
3. 如有任何問題，請聯絡交通部民用航空局初始適航科。Tel：(02)2349-6330 / 6332, Fax：(02)2545-8464,
adcaa@mail.caa.gov.tw

Note： 1. The AD text is enclosed.
2. Exemption, an alternative method of compliance or adjustment of the compliance time may be proposed to the CAA for approval.
3. For further information, please contact Civil Aviation Administration on Tel：(02)2349-6330 / 6332,
Fax：(02)2545-8464, adcaa@mail.caa.gov.tw

[Federal Register, Volume 91 Number 174 (Thursday, September 10, 2026)]
[Rules and Regulations]
[Pages 57491-57492]
From the Federal Register Online via the Government Publishing Office [www.gpo.gov]
[FR Doc No: 2026-18423]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2025-2555; Project Identifier AD-2025-00433-E; Amendment 39-23446; AD 2026-17-03]

RIN 2120-AA64

Airworthiness Directives; International Aero Engines AG Engines; Correction

AGENCY:

Federal Aviation Administration (FAA), DOT.

ACTION:

Final rule; correction.

SUMMARY:

The FAA is correcting an airworthiness directive (AD) that was published in the **Federal Register** . That AD applies to certain International Aero Engines AG (IAE AG) Model V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5 engines. As published, paragraph (g) of the regulatory text contains a typographical error. This document corrects that error. In all other respects, the original document remains the same.

DATES:

This correction is effective September 24, 2026. The effective date of AD 2026-17-03 remains September 24, 2026.

ADDRESSES:

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2025-2555; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule; correction, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket

Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Carol Nguyen, Aviation Safety Engineer, FAA, 2200 South 216th Street, Des Moines, WA 98198; phone: (781) 238-7655; email: carol.nguyen@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

AD 2026-17-03, Amendment 39-23446 ([91 FR 53713](#), August 20, 2026) (AD 2026-17-03), requires replacement of affected 3rd stage High Pressure Compressor (HPC) rotor blades with parts eligible for installation for certain IAE AG Model V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5 engines.

Need for the Correction

As published, paragraph (g) of AD 2026-17-03 contains a typographical error. The word “blade” was inadvertently omitted from the final regulatory text. Paragraph (g) of AD 2026-17-03 should read, “. . . where the 3rd stage HPC rotor blade is exposed . . .,” which is consistent with the intent of the proposed AD ([90 FR 51600](#), November 18, 2025).

Correction of Publication

This document corrects an error and correctly adds the AD as an amendment to [14 CFR 39.13](#). Although no other part of the preamble or regulatory information has been corrected, the FAA is publishing the entire rule in the **Federal Register** .

The effective date of this AD remains September 24, 2026.

Since this action only corrects the typographical error, it has no adverse economic impact and imposes no additional burden on any person. Therefore, the FAA has determined that notice and public procedures are unnecessary.

List of Subjects in [14 CFR Part 39](#)

- Air transportation
- Aircraft
- Aviation safety
- Incorporation by reference
- Safety

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the FAA amends part 39 of the Federal Aviation Regulations ([14 CFR part 39](#)) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: [49 U.S.C. 106\(g\)](#), [40113](#), [44701](#).

[§ 39.13](#) [Corrected]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2026-17-03 International Aero Engines AG: Amendment 39-23446; Docket No. FAA-2025-2555; Project Identifier AD-2025-00433-E.

(a) Effective Date

This airworthiness directive (AD) is effective September 24, 2026.

(b) Affected ADs

None.

(c) Applicability

This AD applies to International Aero Engines AG (IAE AG) Model V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5 engines with a 3rd stage high-pressure compressor (HPC) rotor blade having part number (P/N) 6A8353 or P/N 6A8688 installed.

(d) Subject

Joint Aircraft System Component (JASC) Code 7230, Turbine Engine Compressor Section.

(e) Unsafe Condition

This AD was prompted by multiple reports of failed 3rd stage HPC rotor blades that resulted in engine fires, unplanned engine removals, aborted takeoffs, and in-flight shutdowns (IFSD). The FAA is issuing this AD to prevent failure of the 3rd stage HPC rotor blades. The unsafe condition, if not addressed, could result in engine fire, reduced control of the airplane, and engine IFSD.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

At the next engine shop visit after the effective date of this AD where the 3rd stage HPC rotor blade is exposed, replace the full set of 3rd stage HPC rotor blades with parts eligible for installation.

(h) Definitions

(1) For the purpose of this AD, a “part eligible for installation” is:

(i) A 3rd stage HPC rotor blade having P/N 6C8368, 6C8403, or later approved P/N; or

(ii) A 3rd stage HPC rotor blade modified to P/N 6A8353-001 or P/N 6A8688-001.

(2) For the purpose of this AD, a “3rd stage HPC rotor blade exposure” is when any 3rd stage HPC rotor blade is removed from the HPC stage 3 to 8 drum.

(3) For the purpose of this AD, an “engine shop visit” is the induction of an engine into the shop for maintenance.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, AIR-520 Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in [14 CFR 39.19](#). In accordance with [14 CFR 39.19](#), send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the AIR-520 Continued Operational Safety Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Additional Information

For more information about this AD, contact Carol Nguyen, Aviation Safety Engineer, FAA, 2200 South 216th Street, Des Moines, WA 98198; phone: (781) 238-7655; email: carol.nguyen@faa.gov.

(k) Material Incorporated by Reference

None.

Issued on September 4, 2026.

Brian Knaup,

Acting Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[[FR Doc. 2026-18423](#) Filed 9-9-26; 8:45 am]

BILLING CODE 4910-13-P